



HPC40 Series Operation Manual

for the HPC40 Series Handheld Pressure Calibrator



AMETEK
TEST & CALIBRATION INSTRUMENTS

Contents

Overview	1	Enclosure	21
Introduction.....	1	Specifications	22
Quickstart.....	2	Ranges and Resolutions.....	27
Functions	3	Safety and Certifications	28
On/Off.....	3	Certifications.....	28
Navigation.....	3	Support	29
Settings.....	5	Troubleshooting.....	29
Display.....	8	Calibration.....	30
Operation	9	Accessories and Replacement Parts.....	31
Pressure Sensors.....	9	Contact Us.....	32
Measuring Current.....	13	Warranty.....	32
Sourcing Current.....	14		
Measuring Voltage.....	16		
Measuring Temperature (RTD).....	17		
Performing a Switch Test.....	18		
Calibrating a Pressure Transmitter.....	19		

Overview

INTRODUCTION

Thank you for choosing the HPC40 Series handheld pressure calibrator from Crystal Engineering Corporation. HPC40 calibrators feature deadweight tester accuracy in a modern digital package with the safest fitting connection available. The new full color display also features a new easy to use interface similar to the one used in the JOFRA ASC-400 Series. The HPC40 is available as a stand-alone calibrator or in one of our complete pump systems, and may be used in a broad range of applications from simple tool type jobs to complex calibration jobs in custody transfer systems.

Accuracy is up to 0.035 percent of reading—so one HPC40 can typically replace several gauges or calibrators you may have been using. The HPC40 is fully temperature compensated—so there is no change in accuracy throughout the entire operating temperature range!

Single and dual pressure sensor models are available from vacuum up to 15 000 psi / 1000 bar. In addition, the HPC40 features the ability to add an external pressure port (APM) to provide up to 3 pressure ports. When included with a barometric reference (BARO option), all pressure readings can be displayed as gauge or absolute readings.

In addition to pressure measurement, the HPC40 also includes a full set of electrical connections. Inputs are included for mA, voltage, switch testing, and temperature measurement (RTD). An internal 24 VDC supply is also included to power mA transmitters.

HPC40 Series Measurement Options	
Measurement Type	Available Modes (as defined on display)
Pressure	P1, P2, APM, Diff. Pres, Dual Pres.
Temperature	RTD In
Barometric Pressure	BARO
Current	mA in, mA Out
Voltage	VDC In
Switch Test	Switch Test

HPC40 Series Operation Manual

Other features include:


- User configurable information display
- % error calculation
- Damping
- Leak Testing
- Min/Max hold
- Uses Crystal's new CPF fittings and hose system (leak-free and finger-tight to 10

QUICKSTART



Unique "Non-Menu" User Interface

Easy to use single layer user interface. No deep menu structure! Operate and set up the HPC40 Series to perform your tasks quickly and intuitively.

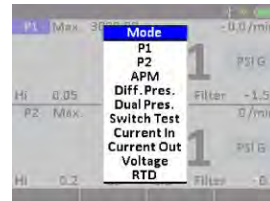

Functions

ON/OFF

Power button



Press and hold the (power) button to turn the HPC40 Series on or off.
The HPC40 will automatically power down if not used for the time period defined in the unit settings or in CrystalControl.

Automatic Shutoff - Low Power Mode

CRYSTALCONTROL To optimize battery life, adjust your **Automatic Shutoff** time (shut off time in absence of key press) on the unit or through the free CrystalControl software. This feature is adjustable from 5 minutes to "always on."

When powered by USB, the HPC40 does not employ any power management strategies. Therefore, it will not automatically shut off to the settings defined by CrystalControl.

NAVIGATION

Arrow Buttons



The (arrow) buttons serve different functions depending on the mode of operation. Press any of the four (arrow) buttons to enter "Navigation Mode". In this mode, the user can scroll through editable fields directly onscreen. Any field that can be edited will be highlighted in blue.

Navigation Mode: Use the four (arrow) buttons to move the cursor in the desired direction.

Edit Mode: Use the Up and Down (arrow) buttons to scroll through lists of options. Or, if entering a number, use the left and right (arrow) buttons to move the cursor one character in the desired direction.

HPC40 Series Operation Manual

Back Button



Press the (back) button to cancel a selection or to return to a previous menu.

Enter Button



Press the (enter) button to view/accept selected options or entered values. When a value is entered with the (enter) button, the cursor selects the next value field in the list.

Zero Button



Press the **(zero)** button to activate the function key options. The HPC40 will display the parameters that are currently shown on the upper and lower displays. Press the **(function)** button for the parameter that you would like to zero. The display will then briefly flash all dashed lines (----), indicating that it has been zeroed.

Note: If you attempt to zero the gauge with more pressure applied than the Zero Limit set on the HPC40 (or with CrystalControl) the command will be ignored, and **Over Zero Limit** will display.

Note: The BARO sensor cannot be zeroed.

! WARNING: This calibrator can display zero pressure when connected to a source of pressure! Do not rely on the display indication before disconnecting—it may not be indicating true pressure. Never disconnect pressure instrumentation without first relieving system pressure!

► To Clear the Zero Value


- 1 Press the **(zero)** button to activate the **(function)** buttons for the available pressure sensors.
- 2 Press and hold the **(function)** button for the sensor that you would like to unzero until the display changes from (----) to (- - -).

► To Clear the Peaks

- 1 Press the **(zero)** button to activate the **(function)** buttons for the available pressure sensors.
- 2 Press the **(function)** button for **Peaks** to reset the P1, P2, and APM peaks.


Navigating Through a Typical Setup

- 1 Press any of the **(arrow)** buttons to enter Navigation Mode. Editable fields will be highlighted in **blue**.
- 2 Use the **(arrow)** buttons to move between the configurable fields within the upper and lower displays. Selected fields will be highlighted in **dark blue**.

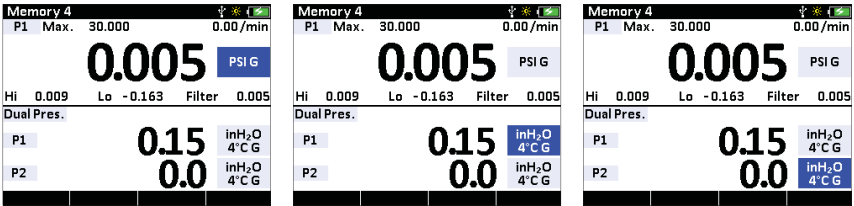

- 3 Use the **(enter)** button to select a field for editing.

4 Use the up and down (arrow) buttons to select a new value, then press the (enter) button to choose the new value.

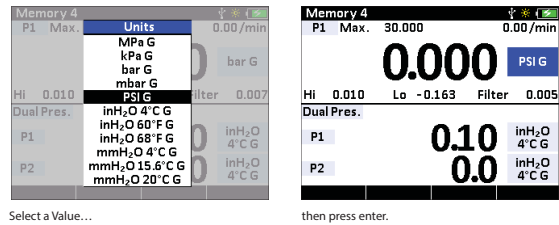

Note: To exit Navigation mode without making a selection, press the (back) button.

SETTINGS

Settings Button



Press the (settings) button to enter the system settings menu.

► Recall

Used to recall a saved setup.

► Save

Used to store the current display setup. Saving a setup allows for quick loading of the same configurations for later use. This makes it easy to switch between different applications or tasks. Up to 5 setups can be stored.

► General

Used to view or edit the following system settings:

- Auto Off Time
- HART resistor On/Off
- Battery Chemistry
- Serial Number
- Firmware Version
- Part Number

► P1, P2, and APM

- Mode: Switch between absolute and gauge pressure.
- Filter Time
- Zero Limit
- Custom Engineering Unit
- Serial Number
- Range
- Maximum Resolution: When a resolution less than standard is selected, the displayed number will include an asterisk (*).
- View Calibration Details

► RTD In

- Define Custom RTD
- Serial Number
- Maximum Resolution: When a resolution less than standard is selected, the displayed number will include an asterisk (*).
- View Calibration Details

► mA In, mA Out, VDC In


- Serial Number
- Maximum Resolution: When a resolution less than standard is selected, the displayed number will include an asterisk (*).
- View Calibration Details

► To Save a Setup


After you have configured the unit, you can save the setup for future use.

- 1 Press the (settings) button to enter the settings section.
- 2 Press the (arrow) buttons to highlight the Save Setting, and then press the (enter) button.
- 3 Press the (arrow) buttons to highlight the setup you want to modify, and then press the (enter) button.
- 4 Use the (arrow) buttons to change the name of the saved setup. When finished press the (enter) button.

The name is limited to eight characters.

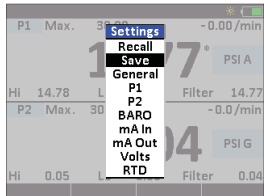

Highlight the settings to modify...

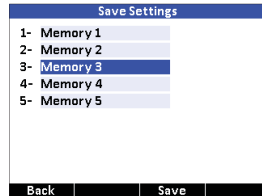


then change the name of the saved setup.

- 5 Press the (F3) function button for Save.


► To Recall a Setup

- 1 Press the (settings) button to enter the settings section.
- 2 Press the (arrow) buttons to highlight the Recall Setting, and then press the (enter) button.
- 3 Press the (arrow) buttons to highlight the setup you want to use, and then press the (enter) button.

The name of the setup will appear in the upper-left corner

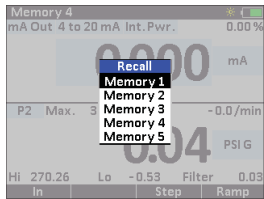


Highlight the setup...

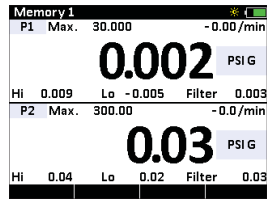

then press enter.

DISPLAY

The display is divided into two sections: the upper and lower displays. The upper display can be configured to show values for Current, Voltage, RTD, Pressure, BARO, or Switch Test. The lower display can be configured to show values for only RTD, Pressure, and BARO.

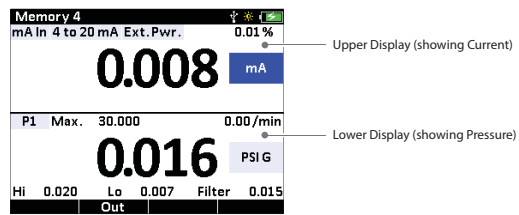

Operation

PRESSURE SENSORS

The HPC40 Series is equipped with one or two pressure sensors. In addition, a Crystal APM (Advanced Pressure Module) may also be used. For information on the Crystal APM, please refer to the [APM CPF Series Operation Manual](#). Be sure to choose the proper sensor based on working pressures and accuracy.

! WARNINGS: The following warnings apply to any sensor used with the HPC40 — whether internal or external:

- Pressure sensors may be damaged and/or personal injury may occur due to improper application of pressure. Please refer to the [Ranges and Resolutions table](#) for information on overpressure ratings.
- The calibrator will display **+OL** when an inappropriate pressure is applied. If **+OL** is displayed, the pressure should be reduced or vented immediately to prevent damage or possible personal injury.

Note: **+OL** is displayed when the pressure exceeds 110% of the nominal range of the sensor.

Pressure Connection

Crystal CPF System: Medium Pressure Female (MPF) (1/4" medium pressure tube system with 7/16-20 threads). See our [CPF Brochure](#) for further information.

CPF o-ring size and material: AS568A-012, Viton 80 or 90 durometer (P/N 3981).

For most applications CPF Fittings can be hand tightened (no tools required). Wrench tightening is recommended (to achieve a metal to metal cone seal) for applications where chemical compatibility of the process fluid and the o-ring are a concern. Cone seals require only moderate assembly torque to seal up to 10 000 PSI (700 bar). We recommend a tightening torque of 120 in-lbs $\pm$ 20 in-lbs for our CPF fittings. Please note this is only a fraction of the typical torque required to seal a 1/4" NPT fitting. If a torque wrench isn't practical to use, the fittings can be assembled as follows: Hand tighten fitting fully until the cone has bottomed out, then tighten an additional 20° using a hex wrench. Apply a small amount of media-compatible lubricant to the gland threads and male cone to increase fitting life, reduce the likelihood of galling, and promote sealing.

! CAUTION: To achieve CPF maximum allowable working pressures no o-ring substitutions are allowed. See our CPF brochure and CES-003 CPF Safety Guide available from the website at crystalengineering.net for further detail.

Measuring Vacuum

All versions of the HPC40 can be used to measure moderate vacuum.

When measuring pressure less than ambient barometric conditions, a minus (-) sign will appear.

! CAUTION: The HPC40 is not recommended for continuous use at high vacuum.

Overpressure Conditions

The HPC40 Series will read pressure up to approximately 110% of the rated pressure range. Above 110%, the display will indicate **+OL**, and readings will stop updating. The zero function does not affect when the display will indicate **+OL**, so depending on the zero value it is possible that the display will indicate **+OL** without the maximum pressure being displayed.

For instance, if a 100 psi range is zeroed when 30 psi is being applied, it will indicate that the overpressure condition has been reached at 80 psi (i.e., 110% x 100 psi – 30 psi = 80 psi).

Overpressure can affect accuracy, but the effect is only temporary unless the sensor has been destroyed. See the [Ranges and Resolutions table](#) for maximum allowable overpressure ratings.


Measuring Pressure

► To Measure Pressure



- 1 Connect the HPC40 using an appropriate fitting.
- 2 Select one of the pressure modes: **P1**, **P2**, **APM**, **BARO**, or **Dual Pres**.

For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).


- 3 From the HPC40 display, select the desired pressure units.

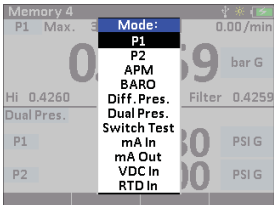

Select a pressure mode...

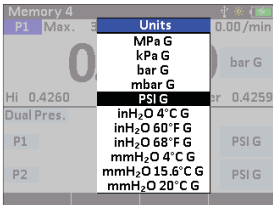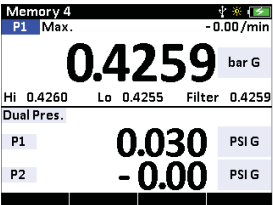

then select a pressure unit.

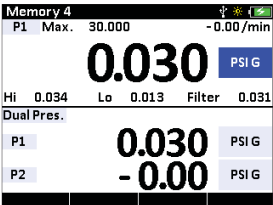


- 4 Apply pressure to the device under test.

► Absolute Pressure (BARO Option)

See [P1, P2, or APM](#) settings to toggle between absolute and gauge pressure.

► To Zero the Calibrator

- 1 Press the (zero) button to activate the (function) buttons for the available pressure sensors.
 - 2 Press the (function) button for the sensor that you would like to zero.
- The display will change to dashed lines (----) and the reading will be zeroed.

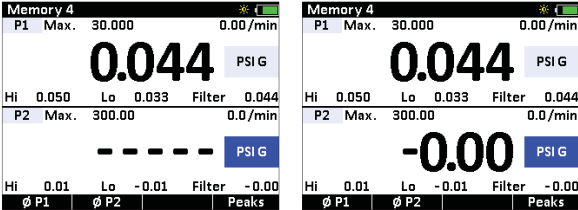

Zeroing the P2 sensor.

► To Clear the Zero Value

- 1 Press the (zero) button to activate the (function) buttons for the available pressure sensors.
- 2 Press and hold the (function) button for the sensor that you would like to unzero until the display changes from (----) to (- - -).

► To Clear the Peaks

- 1 Press the (zero) button to activate the (function) buttons for the available pressure sensors.
- 2 Press the (function) button for **Peaks** to reset the P1, P2, and APM peaks.
- 3 Press the (function) button for the peaks you would like to clear. The **Hi**, **Lo**, and **Filter** will all display (----).

Note: If you attempt to zero the gauge with more pressure applied than the Zero Limit set on the HPC40 (or with CrystalControl) the command will be ignored, and **Over Zero Limit** will display.

Note: The BARO sensor cannot be zeroed.


! WARNING: This calibrator can display zero pressure when connected to a source of pressure! Do not rely on the display indication before disconnecting—it may not be indicating true pressure. Never disconnect pressure instrumentation without first relieving system pressure!

Differential Pressure

The HPC 40 Series can display differential pressure when 2 or more sensors are installed (including external APM). The modules do not have to be the same full scale pressure range.

► To Display Differential Pressure

- 1 Select **Diff. Pres.** from the Mode section.
- 2 Choose the two sensors that you want to use for differential pressure.
- 3 Choose the unit for the differential reading.
For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).
- 4 Apply pressure to one or both sensors to read the differential.

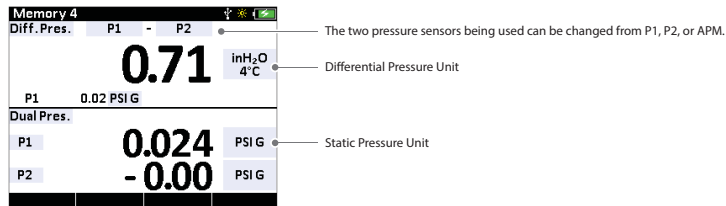

Note: The static pressure is also displayed on the bottom of the window. The unit for the static pressure does not have to be the same as the differential unit.

Tare

Using the Tare function improves your differential measurement uncertainty significantly if used properly. The Tare function equalizes (normalizes) the HPC40's two modules at a non-ambient datum.

If you apply the same static line pressure to both sensors simultaneously, you should have a differential reading of zero. Due to the allowable error tolerance for each module, the reading may not be zero. The Tare function allows you to normalize both readings so that the differential reading is zero. This gives you a more accurate differential reading than if this process were not completed.

Note: Tare should be reestablished every time your measurement conditions change, including vent condition. For instance if your ΔP reading has 8 inH₂O of Tare at 1500 psi static, when you return to vent condition this 8 inH₂O of Tare will remain in place on your ΔP reading until cleared with the Tare button.

To Tare:

- 1 Use the (arrow) buttons to navigate to the Differential Mode view.
- 2 Press the (zero) button to activate the function button options.
- 3 Press the (function) button for the ($\emptyset$ Diff $\uparrow$) icon.

Note: You will notice that the word **Tare** is now included on the top right of the display to indicate that the sensors have been tared.

- 4 To clear the Tare value in the Differential Mode, hold the (function) button for the ($\emptyset$ Diff $\uparrow$) icon for four seconds until the differential display readings change from (- - -) to (- - -). The tare indication will now be removed from the display.

MEASURING CURRENT

The HPC40 is capable of measuring current in four different modes:

- **mA** Measured current is displayed (mA). The module is capable of measuring inputs up to 55 mA.
- **0-20 mA** Current is displayed as a percentage of the 0-20 mA current range of the module. Where: 0 mA = 0%, and 20 mA = 100%
- **4-20 mA** Current is displayed as a percentage of the 4-20 mA current range of the module. Where: 4 mA = 0%, and 20 mA = 100%
- **10-50 mA** Current is displayed as a percentage of the 10-50 mA current range of the module. Where: 10 mA = 0%, and 50 mA = 100%


► To Measure Current

- 1 Select **mA In**.

For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).

- 2 In current mode, the numerical value displayed represents the current measured at the test lead inputs. In the top right corner is a percentage value based on whether **0 to 20 mA**, **4 to 20 mA**, or **10 to 50 mA** is selected.

For example, if the measured current is 16 mA and the selected scale is 4 to 20 mA, the percent will display as 75%.

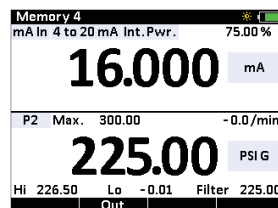

Measuring Current.

- 3 Select **Ext. Pwr.** from the power source list if the mA loop is already powered, or **Int. Pwr.** to have the HPC40 supply the power.

Int. Pwr. is not available in the 10-50 mA range.

- 4 Connect the HPC40 using the appropriate test leads.

- 5 The HPC40 will display the measured current.

Note: The display will indicate **+OL** if the measured current exceeds the nominal range of current measurement (55 mA).


Note: For details on % error and scaling features [see page 20](#).

SOURCING CURRENT

The HPC40 is capable of sourcing up to 25 mA.

► To Source mA (Internal Loop Power Supply)

- 1 Select **mA Out.**
- 2 Select the appropriate range (0-20 or 4-20) if you will be sourcing based on the % of the scale.
- 3 Choose **Int. Pwr.** from the power source list.
- 4 Choose either **mA** (to output a specific mA signal), or **%** (to output based on the % of the mA range).

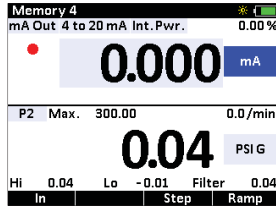

- 5 Connect the HPC40 using the appropriate test lead connections.
- 6 Enter the desired current in mA or % to source.


► mA Sink (External Loop Power Supply)

- 1 Select **mA Out.**
- 2 Select the appropriate range (0-20 or 4-20) if you will be sourcing based on the % of the scale.
- 3 Choose **Ext. Pwr.** from the power source list.
- 4 Choose either **mA** (to output a specific mA signal), or **%** (to output based on the % of the mA range).
- 5 Connect the HPC40 using the appropriate test lead connections.
- 6 Enter the desired current in mA or % to sink.

► **mA Step**

The HPC40 has the ability to automatically or manually step through the mA range at predefined intervals.

- 1 Select **mA Out**.
- 2 Select the appropriate mA range (0-20, 4-20).
- 3 Select **Ext. Pwr.** from the power source list if the mA loop is already powered, or **Int. Pwr.** to have the HPC40 supply the power.
- 4 Press the (function) button for **Step**.
- 5 Enter the 0 and 100% mA points. For example, if you're sourcing to a 4-20 mA loop, enter 4 for the 0% point and 20 for the 100% point.
- 6 Choose the step size from 10%, 20%, or 25%. This is the percent of the mA range that will be increased with each step.
- 7 Enter the time between each step you would like to use.

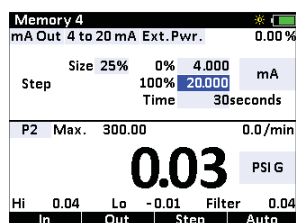


- 8 Press the (function) button for **Auto**, and the HPC40 will automatically start the step process.
- 9 Press the (function) button for **back** when finished. Or, if you would like to pause the step function and increase manually, press **Stop**. If you press **Stop**, new function keys **-Step** (decreasing a single step) and **+Step** (increasing a single step) are now available.

► **mA Ramp**

The HPC40 has the ability to provide a consistent ramp throughout the full mA range.

- 1 Select **mA Out**.
- 2 Select the appropriate mA range (0-20, 4-20).
- 3 Select **Ext. Pwr.** from the power source list if the mA loop is already powered, or **Int. Pwr.** to have the HPC40 supply the power.
- 4 Press the (function) button for **Ramp**.
- 5 Enter the 0 and 100% mA points.

- 6 Enter the total time to get from 0 to 100% of the scale.

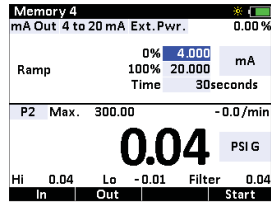


- 7 Press the (function) button for **Start** and the HPC40 will begin the ramp process.
- 8 Press the (function) button for **Stop** to pause the ramp, or **Back** to go back to the ramp setup screen.

MEASURING VOLTAGE

The HPC40 may be used to measure voltages up to 30VDC. Voltage measurements are limited to the upper display.

► To Measure Voltage

- 1 Select **VDC In**.

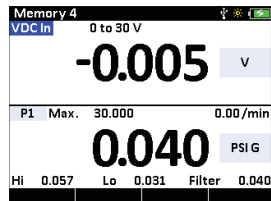

For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).

- 2 Connect the HPC40 using the appropriate test leads.
- 3 The HPC40 will indicate the measured voltage.
- Note:** The display will indicate **+OL** if the measured voltage exceeds the nominal range of voltage measurement (30 VDC).

MEASURING TEMPERATURE (RTD)

Your HPC40 has the ability to measure temperature very accurately using “true ohm” technology. True ohm resistance measurement eliminates temperature reading errors by compensating for thermoelectric effects associated with the wires and connections between the RTD and the HPC40. The HPC40 will also indicate electrical resistance (Ω) to help in troubleshooting your resistance based sensing element.

RTDs are characterized by their 0°C resistance, R_0 . The HPC40 accepts -2, -3, and -4 wire inputs, with 4 wire input being the most accurate.


The HPC40 is compatible with a large number of platinum RTD probe types. Ametek offers a platinum 100 probe that is ready to connect directly to the HPC40's RTD port. See [Accessories and Replacement Parts](#) for details.

► To Measure Temperature

- 1 Select **RTD In**.

For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).

- 2 In RTD mode select an RTD type from the RTD Type list.

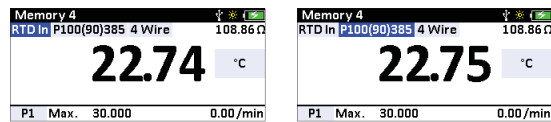

Select RTD...

then select an RTD type.


- 3 Select a wire connection from the Num Wires list: **2-wire**, **3-wire**, or **4-wire**.

4-wire allows for the most accurate measurement

- 4 Select the appropriate unit from the list.

- 5 Connect your RTD probe to the HPC40.

If you have our probe (PN 127387), plug it in to the HPC40's RTD port and select probe type P100(90)385, 4-wire. If you wish to connect your own RTD probe, you may do so by connecting your probe wires per the HPC40 RTD port diagrams below, and using a mating connector from Lemo's 15.304 series.

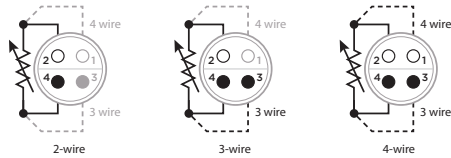

- 6 The HPC40 will display the measured temperature.

Note: **+OL** will be displayed if the probe resistance is greater than 400 Ohms and/or the calculated temperature is outside the range defined for the probe. Temperature range depends on the probe type.


HPC40 Series Operation Manual

PERFORMING A SWITCH TEST

Performing a switch test will require the use of both screens. The HPC40 records switch state, and pressure or temperature measurement at the time of switch change. After the test, the result is displayed in a convenient and easy-to-use format.

► To Perform a Switch Test

- 1 Select **Switch Test** in the upper display.
- 2 FOR A PRESSURE SWITCH, select **P1, P2, Diff. Press., or APM** in the lower display.
FOR A TEMPERATURE SWITCH, select **RTD** in the lower display.
For more information on working in the HPC40 display, see [Navigating Through a Typical Setup](#).
- 3 Connect the HPC40 to the switch using the terminals on the top of the HPC40. (The polarity of the terminals does not matter.)
- 4 FOR A PRESSURE SWITCH, connect a pump to the HPC40 and then to the switch.
FOR A TEMPERATURE SWITCH, connect an RTD to the HPC40 connection and place the RTD and temperature sensor in a temperature calibrator.
- 5 Check that the vent on the pump is open, and zero the calibrator if necessary. Then close the pump vent.
The upper display will show no read outs for the **Closed**, **Opened**, and **Dead band** values.

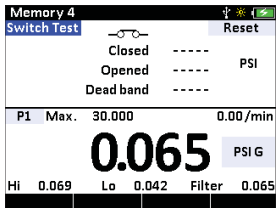

- 6 Slowly apply pressure or temperature until the switch opens.
Once the switch is open, the switch icon will change to , and the display will indicate pressure at which the switch opened.
- Note:** In the switch test mode, the display update rate is increased to ten readings per second to help capture the changing switch state. Even with this enhanced sample rate, pressurizing the device under test should be done slowly to ensure accurate readings.

7 Decrease pressure or temperature until the switch closes.

Once the switch closes, the icon will change to (—○—) and the **Closed** value and **Dead band** value will be indicated.

Memory 4				  	
Switch Test				Reset	
	Closed	-----		PSI	
	Opened	229.68			
	Dead band	-----			
P2	Max.	300.00	- 30.9/min		

Switch Open

Memory 4				  	
Switch Test			Reset		
					
	Closed	133.37	PSI		
	Opened	229.68			
	Dead band	96.31			
P2	Max.	300.00	- 26.3/min		

Switch Closed

8 To perform a new test, highlight the reset option and press the (enter) button.

The **Closed**, **Opened**, and **Dead band** value will all be blank again.

Note: The procedure is the same whether the default mode for the switch is opened or closed. So for example, applying pressure or temperature to an open switch will cause the switch to close, and the icon will change to (—○—) as in step 7 above.

CALIBRATING A PRESSURE TRANSMITTER

When calibrating a transmitter, both the upper and lower displays are used. Pressure and Temperature Transmitters with ranges of 0 to 20 mA, 4 to 20 mA, and 10 to 50 mA can be calibrated by an HPC40. The example below will use a 4 to 20 mA pressure transmitter.

► To Calibrate a Pressure Transmitter

1 Select **mA In** in the upper display and **P1** in the lower display.

2 Select **4 to 20mA** from the Range list.

3 Select **Ext. Pwr.** from the power source list if the mA loop is already powered, or **Int. Pwr.** to have the HPC40 supply the power.

Memory 4		Ext. Pwr.		0.01 %	
mA In 4 to 20 mA				mA	
Range					
4 to 20 mA					
0 to 20 mA					
10 to 50 mA					
P1 Max. S				- 0.00/min	
				PSI G	
Hi 0.071	Lo 0.040	Filter 0.065			
Out					

Select 4 to 20mA...

Memory 4		mA In 4 to 20 mA		Ext. Pwr.	0.01 %
		0.005		mA	
		24V Power			
P1	Max.	3	Ext. Pwr.	0.00/min	
		Int. Pwr.			
		0.066		PSI G	
Hi	0.071	Lo	0.040	Filter	0.065
		Out			

then select Int. Pwr. or Ext. Pwr.

4 Connect the HPC40 to the transmitter.


► HART Resistor

The HPC40 has an internal 250 Ohm HART resistor that can be selected if desired. With the (settings) button, choose **General** to select HART resistor On or Off.

► Percent Error Function

The HPC40 can be programmed to calculate a deviation or % error from 4-20 mA output. This eliminates the need for manual calculations and can also be helpful if it becomes difficult to set an exact pressure with an external pump. The HPC40 simultaneously displays pressure, mA, and percent error.

- 1 Select **% Error** from the mA units selection in the upper window.
- 2 Use the (arrow) buttons to set the 0 and 100% points for both the mA and pressure ranges of the transmitter.

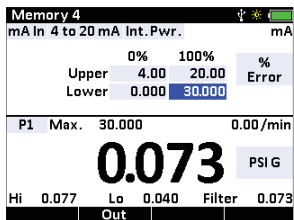

- 3 Increase pressure to the desired point and the HPC40 upper display will indicate the % error as well as the actual mA value. The lower display will show the measured pressure.

► Scaling Function


The HPC40 has the ability to read current or voltage in the upper display that is scaled to and displayed in the same units as the lower display. This makes it much easier to compare a mA reading to a known accurate pressure reading.

- 1 Select **Scaling** from the mA units selection in the upper window.
- 2 Use the (arrow) buttons to set the 0 and 100% points for both the mA (or VDC) and pressure ranges of the transmitter.
- 3 Increase pressure to the desired point and the HPC40 upper display will indicate the equivalent pressure based on the mA reading, as well as the actual mA value. The lower display will show the measured pressure.

Enclosure

INFORMATION

Weight 689 g (24.3 oz) (includes batteries).
 Housing Machined aluminum; hard anodized.
 Rating IP65.
 Keypad and Labels UV Resistant Silicone.

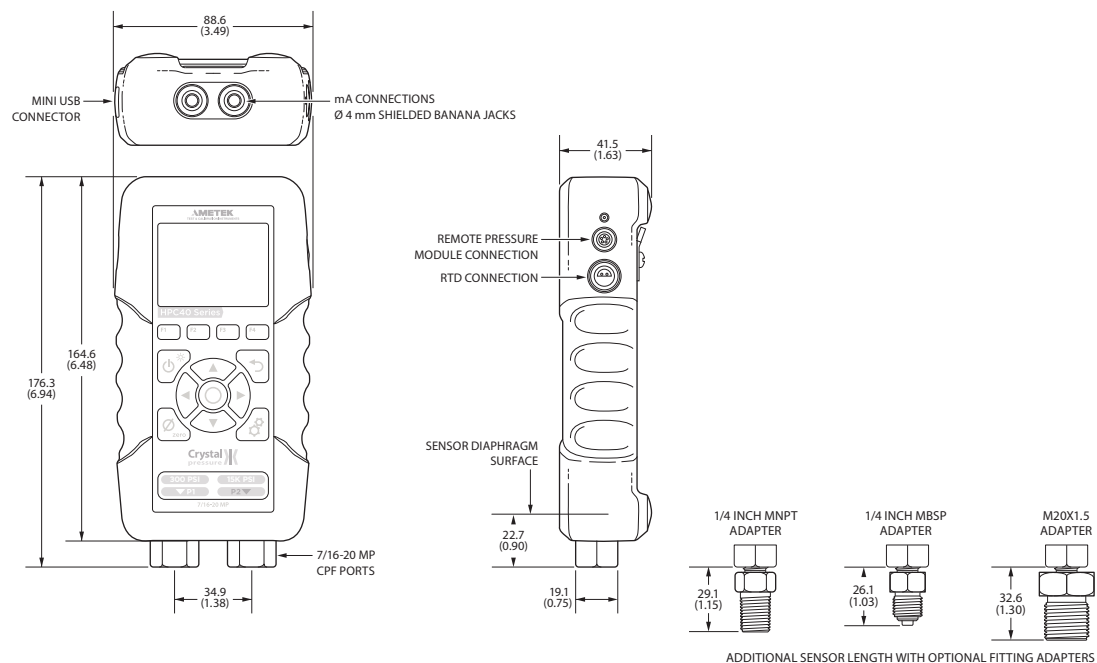

HPC40 Series Operation Manual

Specifications

Gauge Pressure Accuracy

Includes all effects of linearity, hysteresis, repeatability, temperature, and stability with the operating temperature range for one year.

Note: Exposure to environmental extremes of temperature, shock, or vibration may warrant a more frequent calibration period.

The HPC40 Series must be exercised and re-zeroed whenever exposed to significant changes in environmental conditions to achieve these specifications. To exercise a gauge, cycle the gauge between zero (ambient barometric pressure) and the pressure of interest. A properly exercised gauge will return to a zero reading (or return to the same ambient barometric reading).

► Gauge Pressure (psi)

• 18 to 28° C

0 to 30% of Range $\pm(0.01\%$ of Full Scale)
 30 to 110% of Range..... $\pm(0.035\%$ of Reading)
 Vacuum* $\pm(0.05\%$ of Full Scale**)

• -20 to 50° C

0 to 30% of Range $\pm(0.015\%$ of Full Scale)
 30 to 110% of Range..... $\pm(0.050\%$ of Reading)
 Vacuum* $\pm(0.05\%$ of Full Scale**)

*Applies to 300 psi and lower ranges only.

**Full Scale is the numerical value of the positive pressure range.

CAUTION: Not recommended for continuous use below -14.5 psig. Refer to the [XP2i-DP](#) data sheet for gauges that are intended for continuous high vacuum use.

► Absolute Pressure with BARO Option (psiA)

All absolute accuracies are equivalent to the gauge pressure accuracies, except as noted below.

30 psi Range Gauge Accuracy +0.005 psiA
 100 psi Range Gauge Accuracy +0.002 psiA

Pressure Conversions

1 PSI = 27.6806 inches of water column (water at 4°C [39.2°F])
703.087 millimeters of water column (water at 4°C [39.2°F])
70.3087 centimeters of water column (water at 4°C [39.2°F])
2.03602 inches of mercury (mercury at 0°C [32°F])
51.7149 millimeters of mercury (mercury at 0°C [32°F])
6.8948 kilopascals
0.070307 kilograms per square centimeter
0.068948 bar
68.948 millibar
0.0068948 megapascals

Note: Other conversions may have been specified at time of order. Refer to your certificate of calibration for details.

Temperature

Accuracy ±(0.015% of rdg) + 0.02 Ohm
Range 0 – 400 Ohms
Resolution 0.01 on all scales
Units °C, K, °F, R, Ω
Types 13 standard and 1 custom
Wiring 2-, 3-, and 4-wire support
Connection Lemo Plug, 15 Series, 304 insert configuration

Electrical

All accuracy specifications include all effects of linearity, hysteresis, repeatability, temperature, and stability within the specified operating temperature range for one year.

Note: Exposure to environmental extremes of temperature, shock, and/or vibration may warrant a more frequent recertification period.

Connection.....4 mm jacks
Maximum Voltage45 VDC

► Current (mA) Input

Accuracy±(0.015% of rdg + 0.002 mA)
mA Range0 to 55 mA
Percent Range0-20, 4-20, 10-50
Max Allowable Current.....60 mA
Resolution.....0.001 mA or 0.01%
UnitsmA and %
Input Resistance.....< 17.2 Ω
Voltage Burden @ 20mA< 0.35 V
Voltage Burden @ 50mA< 0.86 V
HART Resistor250 Ω

► Current (mA) Output

Accuracy± (0.015 of rdg + 0.002 mA)
Range0 to 25 mA*
**From 0.001 to 0.05 mA, add 0.02 mA to accuracy.*
Step Time1 to 999 seconds
Ramp Time5 to 999 seconds

Voltage (VDC) Input

Accuracy±(0.015 % of rdg + 2 mV)
Range.....0 to 30 VDC
Resolution.....0.001 VDC
Input Impedance> 1 MOhm

► Loop Power

Fixed Output24 VDC
Voltage Output Accuracy± 10%
Maximum Output Current.....25 mA

► Switch Test

Switch TypeDry Contact
Closed State Resistance.....< 1K Ω
Open State Resistance> 100K Ω
Sample Rate:10 Hz

Display

Screen.....320 x 240 pixel graphical display
Display Rate3 readings/second (standard)
10 readings/second (switch test and peak hi/lo modes)

Operating and Storage Temperature

Operating Temperature Range ...-20 to 50° C (-4 to 122° F)
Storage Temperature Range.....-40 to 75° C (-40 to 167° F)

RANGES AND RESOLUTIONS

psi	bar	kPa/MPa	Overpressure	psi	kg/cm ²	inHg	inH ₂ O	mmHg	mmH ₂ O	kPa	bar	mbar	MPa
30PSI			3.0 x	0.001	0.0001	0.001	0.01	0.01	1	0.01	0.0001	0.1	
	3BAR		3.0 x	0.001	0.0001	0.001	0.01	0.01	1	0.01	0.0001	0.1	
		300KPA	3.0 x							0.01	0.0001	0.1	
100PSI			2.0 x	0.001	0.0001	0.01	0.1	0.1	1	0.01	0.0001	0.1	0.00001
	10BAR		2.0 x	0.001	0.0001	0.01	0.1	0.1	1	0.01	0.0001	0.1	0.00001
		1MPA	2.0 x							0.01	0.0001	0.1	0.00001
300PSI			2.0 x	0.01	0.001	0.01	0.1	0.1		0.1	0.001	1	0.0001
	30BAR		2.0 x	0.01	0.001	0.01	0.1	0.1		0.1	0.001	1	0.0001
		3MPA	2.0 x							0.1	0.001	1	0.0001
1KPSI			2.0 x	0.01	0.001	0.1				0.1	0.001		0.0001
	100BAR		2.0 x	0.01	0.001	0.1				0.1	0.001		0.0001
		10MPA	2.0 x							0.1	0.001		0.0001
3KPSI			1.5 x	0.1	0.01	0.1				1	0.01		0.001
	300BAR		1.5 x	0.1	0.01	0.1				1	0.01		0.001
		30MPA	1.5 x							1	0.01		0.001
10KPSI			1.5 x	0.1	0.01					1	0.01		0.001
	700BAR		1.5 x	0.1	0.01					1	0.01		0.001
		70MPA	1.5 x							1	0.01		0.001
15KPSI			1.3 x	0.1	0.01					1	0.01		0.001
	1000BAR		1.3 x	0.1	0.01					1	0.01		0.001
		100MPA	1.3 x							1	0.01		0.001

► Ordering Information

Number of Sensors	1st Pressure Range P/N	2nd Pressure Range P/N	BARO Option	Adapter
HPC41 ... (Single)			No (omit)	1/4 NPT (omit)
HPC42 ... (Dual)			Yes ... -BARO	G 1/4 B -BSP
				M20x1.5 ... -M20

SAMPLE PART NUMBERS

HPC41-1KPSI Single Sensor (1000 psi) HPC40 with a 1/4" NPT pressure fitting.

HPC42-3BAR-700BAR-BSP-BARO Dual Sensor (3 bar/700 bar) HPC40 with a 1/4" BSP pressure fitting and BARO option.

The HPC40 Series has been tested and certified to comply with a variety of international standards.



EMC EC Declaration of Conformity

PED EC Declaration of Conformity

HPC40 Series Operation Manual

TROUBLESHOOTING

The HPC40 Series is a very high performance calibrator. Due to the high resolution of this product, you may observe conditions that appear to be defects in the product, but are in fact a result of being able to read and measure pressure to a degree not possible with other instruments.

Noisy or unstable reading when used with fluids

When calibrating or comparing the indicated pressure from an HPC40 against a hydraulic deadweight tester or piston gauge, the reading on the HPC40 may appear unstable—the least significant digit jumps up and down several counts.

► Reason

Gas (usually air) is trapped in the line between the HPC40 and the deadweight tester. What is actually happening is the mass is oscillating up and down, and the combination of gas and fluid is acting like a spring. At higher pressures (above 2000 psi, typically) this may eventually diminish, as the gas dissolves into the fluid.

► Solution

Evacuate all tubing with a vacuum pump before introducing fluid into the system.

Non-repeatability of pressure measurements

When checking the calibrator against a hydraulic deadweight, increasing pressure measurements do not match decreasing pressure measurements.

► Reason

As in the previous note, gas has dissolved into the hydraulic fluid. When decreasing the pressure, the dissolved gas then leaves the fluid, but at an uneven rate, so a small pressure differential (due to fluid head pressure) may exist between the reference deadweight and the gauge being tested.

► Solution

Evacuate all tubing with a vacuum pump before introducing fluid into the system.

Slow return to zero and/or non-repeatability of pressure measurements**► Reason**

Pressure port is obstructed.

► Solution

Clean with low pressure fluid. Do not touch diaphragm as damage will result.

CALIBRATION

If adjustment is required, we recommend returning the HPC40 to the factory. Factory service offers benefits you won't find anywhere else. Factory calibration tests your HPC40 at a variety of temperatures utilizing NIST traceable standards, resulting in calibration certificates that provide performance data over temperature. Our calibration facilities are A2LA accredited (cert #2601.01) to ISO 17025:2005 & ANSI/NCCL Z540-1-1994. A2LA is internationally recognized as an accreditation body by the International Laboratory Accreditation Cooperation, ILAC. Furthermore, upgrades may be available to add or enhance operating features. We designed the product to last, and we support it so that you can get the most from your investment.

Under normal operating conditions, we recommend the HPC40 be calibrated on an annual basis. Your quality system may require more or less frequent calibration, or your experience with the gauge, or operating environment may suggest longer or shorter intervals.

Although we prefer that you return the HPC40 to us for calibration, ordinary recertification and/or adjustments may be performed by any qualified personnel with appropriate training and equipment. The following instructions are ONLY intended for such qualified personnel with appropriate test equipment. We recommend that the calibration standards used have a minimum rated accuracy of 0.008% of reading, or equivalent in terms of percent of full scale. This level of accuracy requires the use of piston (deadweight) gauges or very high performance pressure controllers.

CRYSTALCONTROL There are no internal potentiometers. Each of the HPC40's sensors has a "span factor" (userspan), set to approximately 1 (as shipped from the factory). As components age this may need to be changed to a value slightly higher or lower, to slightly increase or decrease all readings. This adjustment can be made with a computer through CrystalControl.

Calibration of P1 and P2

CRYSTALCONTROL "Zero" the HPC40, then record displayed pressure for two or more pressure points. Determine if the HPC40 would benefit from an overall increase or decrease of the indicated pressures. Adjust userspan accordingly and validate results.

Calibration for Barometric Reference Module (BARO)

CRYSTALCONTROL The BARO module can be calibrated by selecting the Edit Calibration Data button while within the BARO Config screen. Enter Userspan and Offset information directly, or you can use the Calibration Wizard to calculate the optimum values for a 1 or 2 point calibration.

1 Remove the mounting bracket on the back of the HPC 40, exposing the barometric sensor port.

2 Connect a flexible 4.8 mm [3/16"] ID tubing from your clean pneumatic calibration reference to the BARO sensor.

- ! CAUTION:** Do not subject the BARO sensor to pressures less than 700 mbarA (10.153 PSIA), or greater than 1100 mbarA (15.954 PSIA), as this may cause permanent damage. Use only clean a clean dry pneumatic source.
- ! CAUTION:** Direct contact with the surface of the BARO sensor may cause permanent damage. Direct sunlight on exposed BARO sensor may affect readings slightly.

ACCESSORIES AND REPLACEMENT PARTS

P/N 2368 Test Lead Kit

Lead Kit, Red and black test leads with clips. (Included as standard)

P/N 5241 Protective Boot

Skydrol™ resistant protective boot. (Included as standard)

P/N 3951 Mini-USB Cable

The durable and high-speed Micro-USB cable enables data transfer in the most convenient form. (Included as standard)

P/N 3009 Hard Carrying Case

Aluminum carrying case with molded eggshell foam interior.

P/N 2888 Waterproof Carrying Case

Hard plastic carrying case with molded eggshell foam interior.

P/N 127387 RTD Probe

Pt100 Probe with 4-pol LEMO .

MP40 Series Operation Manual

P/N 5940 4AA Rechargeable Batteries

Package of 4.

MPM-1/4MPT CPF Male to 1/4" Male NPT Fitting

(Included as standard)

MPM-1/4BSPM CPF Male to 1/4" Male BSP Fitting

(Included with -BSP)

MPM-M20x1.5M CPF Male to M20 Male Adapter

(Included with -M20)

CONTACT US

* ISO 17025 accredited calibration lab, (A2LA #2601.01). ** DIN EN ISO / IEC 17025 accredited calibration lab. *** DANAK EN ISO/IEC 17025 accredited calibration lab.

If calling, have ready the model number, serial number, date of purchase, and reason for return. You will receive instructions for returning the device to us.

WARRANTY

Crystal Engineering Corporation warrants the HPC40 Series Calibrator to be free from defects in material and workmanship under normal use and service for one (1) year from date of purchase to the original purchaser. It does not apply to batteries or when the product has been misused, altered or damaged by accident or abnormal conditions of operation.

Crystal Engineering will, at our option, repair or replace the defective device free of charge and the device will be returned, transportation prepaid. However, if we determine the failure was caused by misuse, alteration, accident or abnormal condition of operation, you will be billed for the repair.

CRYSTAL ENGINEERING CORPORATION MAKES NO WARRANTY OTHER THAN THE LIMITED WARRANTY STATED ABOVE. ALL WARRANTIES, INCLUDING IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR ANY PARTICULAR PURPOSE, ARE LIMITED TO A PERIOD OF ONE (1) YEAR FROM THE DATE OF PURCHASE. CRYSTAL ENGINEERING SHALL NOT BE LIABLE FOR ANY SPECIAL, INCIDENTAL OR CONSEQUENTIAL DAMAGES, WHETHER IN CONTRACT, TORT OR OTHERWISE.

Note: (USA only) Some states do not allow limitations of implied warranties or the exclusion of incidental or consequential damages, so the above limitations or exclusions may not apply to you. This warranty gives you specific legal rights and you may have other rights which vary from state to state.



5369.C

