


Dual Moisture Meter

Pin / Pinless Moisture Meter

Model MO260

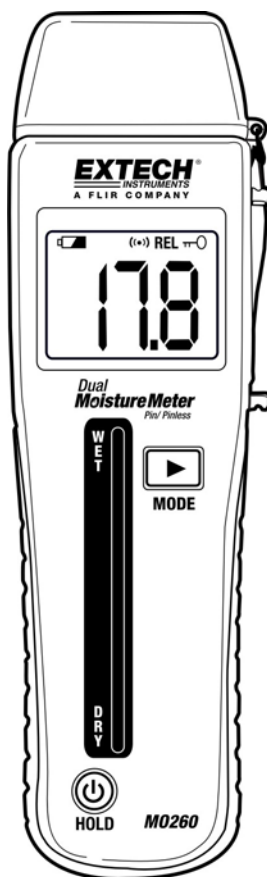

Introduction

Congratulations on your purchase of the Extech MO260 Moisture Meter. The MO260 detects moisture in wood and other materials such as particle board, carpeting, and ceiling/bathroom tiles using the non-invasive method (pinless); the MO260 also measures moisture in sheet rock and other building materials using the pin method. This meter is shipped fully tested and calibrated and, with proper use, will provide years of reliable service.

Features

- %WME (wood moisture equivalent) pin moisture reading
- Relative (REL) pinless moisture reading for non-invasive measurement
- Digital LCD readout with backlighting feature and tri-color LED bargraph
- Quickly indicates the moisture content of materials
- Pinless measurement depth to 0.75" (22mm) below the surface
- Electro-magnetic sensing technology for pinless operation
- Built-in calibration check and calibration zero
- Replaceable measurement electrode pins
- Low battery indication
- Cap protects pins during storage
- Cap can be snapped onto the side of the housing during use
- Complete with 9V battery, replacement pins, protective cap, and pouch case


Description

Meter Description

1. Electrode pins protective cap
2. LCD display
3. Tri-color Bargraph
4. HOLD / POWER key
5. Protective cap attachment
6. Protective cap holders
7. MODE button


Notes:

- Battery/Spare Pin compartment located on the rear of the instrument
- Electrode pins located beneath the protective cap
- Calibration points located at the top of protective cap

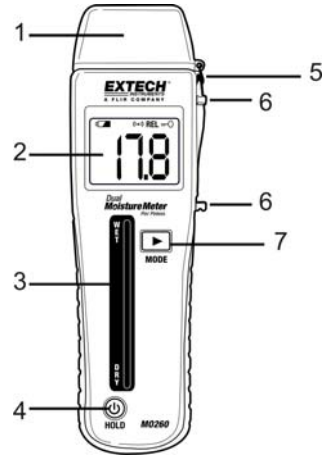

LCD Display Description

1. Measurement reading
2. Battery status
3. Audible alert icon
4. Measurement mode
5. Display HOLD icon

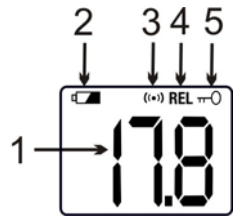

Bargraph Display Description

The bargraph indicates WET / DRY measurements using three LED colors: Green (for dry), Amber (for moderate moisture), and Red (for very moist). As the reading moves up the bargraph scale from the DRY indicator to the WET indicator, the LED color changes from green, to amber, and then to red.



Operation


Electrode Pins

CAUTION: The electrode measurement pins are extremely sharp. Use care when handling this instrument. Cover the pins with the protective cap when the instrument is not in use.

The electrode pins are replaceable / removeable and must be inserted before the meter can be used. To insert or replace the pins refer to the illustration and instructions below. Replacement pins are stored in the battery compartment at the rear of the meter.

- a) Remove the protective cap at the top of the meter by pushing it toward the back of the meter.
- b) To remove the pins, loosen the locknut at the base of the electrode pins
- c) Install the new pins and tighten the locknuts
- d) Replace the protective cap

1. Electrode pins
2. Locking nuts
3. Threaded posts
4. Electrode jacks at top of meter

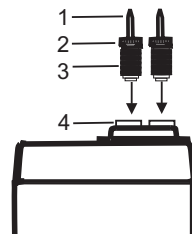

Basic Operation for Pin Measurements

1. Remove the protective cap to expose the electrode pins. The cap snaps off easily if it is pushed towards the rear of the meter. The cap can be affixed to the side of the meter using the protective cap holders (6).
2. Press the  key to turn the meter ON / OFF.
3. Press the **MODE** key to select the Wood Moisture Equivalent (%WME) mode of operation.
4. Carefully push the electrode pins a minimum of 0.07" (2mm) into the material under test. Note that the pins should be inserted into wood perpendicular to the wood's fiber structure. For high moisture readings, it may take several minutes for the meter reading to stabilize.
5. Take several readings in several locations on the material for the best representation of the amount of moisture present.
6. Read the measurement values on the LCD digital display and the LED bar graph
7. Replace the protective cap when finished.

Basic Operation for Pinless Measurements

See section on how a Pinless meter measures moisture.

1. Ensure that the protective cap is attached to the meter covering the pins.
2. Press the  key to turn the meter ON.
3. Press the **MODE** key to select the Relative (REL) mode of operation.
4. The pinless moisture detector is located at the rear of the instrument, just behind the display. Place the meter so that the sensor is touching the surface of the material under test.
5. Take several readings in several locations on the material for the best representation of the amount of moisture present.
6. Read the measurement values on the LCD digital display and the LED bar graph.

Calibration Zero for Pinless Mode

1. Switch the meter to the Pinless mode of operation (REL mode).
2. Ensure that the meter is not near any objects or surfaces. Hold the meter near the bottom to avoid contact with the pinless sensor.
3. Press and Hold the MODE button for 3 seconds until rEL appears in the display. Release the MODE button and the display will blink for several seconds and then switch back to the normal display mode.
4. The display should now read zero indicating that the calibration is complete.
5. If an E32 error is displayed, try the zero calibration again with the pins further away from any objects or surfaces.

Calibration Check for Pin Mode

1. Switch the meter to the Pin mode (%WME).
2. The two calibration check points are located in the holes at the top of the protective cap.
3. Insert the electrode pins into the two holes at the top of the protective cap to make contact with the test circuit.
4. The display should now read from 18.0 to 18.6, indicating that the calibration is verified. If the reading is not correct, return the meter for service.

LCD Backlight ON/OFF

With the meter switched ON, pressing and holding both front panel buttons (MODE and HOLD) switches the LCD backlight ON and OFF.

Data Hold feature

The Data Hold function freezes the reading in the display. Press the **HOLD** key momentarily to activate the Data Hold function. The reading will freeze and the 'key' display icon will appear. Press the **HOLD** key again to exit the Data Hold function (the 'key' display icon will switch off).

Meter Setup

- To enter the setup mode:
With the meter switched OFF, press and hold both front panel buttons (MODE and HOLD buttons) simultaneously for two seconds. The display should now read '0 = x' where '0' is the OPTION and 'x' is the SETTING.
- Use the MODE (right arrow) button to change the SETTING.
- Use the HOLD button to scroll through the OPTIONS.
- The available OPTIONS and SETTINGS:

OPTIONS	SETTINGS	SET-UP INFORMATION
0	0	Switches all settings to '0' (Factory Default*)
	1	Others settings can now be changed. In addition, Backlight switches ON for 30 seconds and then automatically switches OFF.
1	0	Audible alert beeps with increasing frequency from a nominal 17.0 (REL) or 17% (WME) measurement value upwards
	1	Audible alert divided into 3 frequency levels
	2	Audible alert beeps when user switches from one mode to another
	3	Beeper OFF. Audio alert display symbol switches OFF
2	0	Auto Switch OFF is not active. User must manually switch the unit OFF
	1	Auto Switch OFF active. Switches OFF after 3 minutes
	2	Auto Switch OFF active. Switches OFF after 5 minutes
	3	Auto Switch OFF active. Switches OFF after 10 minutes
3	0	Backlight OFF
	1	Backlight ON

*FACTORY DEFAULT SETTINGS: 0=0, 1=0, 2=0, 3=0

Battery Replacement

If the instrument does not switch ON or displays the low battery symbol, replace the battery as follows:

1. Slide off the rear battery compartment cover
2. Replace the 9V battery
3. Secure the battery compartment
- 4.



Never dispose of used batteries or rechargeable batteries in household waste.

As consumers, users are legally required to take used batteries to appropriate collection sites, the retail store where the batteries were purchased, or wherever batteries are sold.

Disposal: Do not dispose of this instrument in household waste. The user is obligated to take end-of-life devices to a designated collection point for the disposal of electrical and electronic equipment.

Maintenance

- Always keep the instrument dry
- To clean, wipe the meter with a damp cloth. Use a mild detergent if necessary but never use abrasives or solvents.
- Prevent dirt from accumulating at the electrode pins

How a Pinless Moisture Meter Measures Moisture

A pinless meter is a “relative” or unit-less measurement device.

Unlike the PIN type moisture meter that measures %WME or electrical resistance, the Pinless meter measures an electrical property of the material called relative permittivity. A pinless meter uses an Electromagnetic signal to check the permittivity of a material.

The proper way to use a pinless meter is to make a measurement of a material of a known dryness. Then make a measurement of an item of the same material, thickness, and construction of unknown moisture content. Any rise in reading indicates moisture, or the presence of some other conductor or high permittivity material (a metal stud behind the wall would produce higher readings).

Making multiple measurements over the suspected area is recommended to get an average reading of the material. Practice and experience will help you to get a feel for the moisture content in that material.

Specifications

Display	Backlit LCD digital display and tri-color LED bargraph scale
Resolution	0.1%
Accuracy	Pin mode: $\pm$ (5% rdg + 5 digits) Pinless mode is a relative reading only
Measurement principle	Electrical resistance (pins) Electromagnetic sensor (pinless)
Range	0.0 to 99.9 %Relative (pinless) 6.0 to 94.8 %WME (pins)
Electrode pin length	11mm (0.44")
Electrode pin type	Integrated, replaceable
Power supply	9V alkaline battery
Low Battery Indication	Battery symbol displayed on LCD
Meter housing	Impact-proof plastic
Operating Temperature	0 to 50°C (32 to 122°F)
Operating Humidity	80% Relative Humidity maximum
Dimensions	203 x 58 x 43mm (8 x 2.3 x 1.7")
Weight	204g (7.2 oz)

Copyright © 2014-2016 FLIR Systems, Inc.

All rights reserved including the right of reproduction in whole or in part in any form

ISO-9001 Certified

www.extech.com