

# Model 898X Model 899X



# **Electronic Preset Counter**

with two presets

# Contador electrónico de preselección con dos preselecciones

# **Flektronischer** Vorwahlzähler

mit zwei Vorwahlen

# Compteur à présélection électronique

avec deux présélections

# Contatore elettronico a preselezione

con due preselezioni

# Table of Contents (German is the original version)

1	Pref	ace			4
2	Safe	ty instru	actions and Warnings	4	4
	2.1	Use acc	ording to the intended purpos		4
	2.2		g in a control panel		4
	2.3		al Installation	!	5
	2.4	Cleaning	g and maintenance	!	5
3		cription			5
4	Disp	lay/Ope	rating elements		6
5	Inpu	ts			6
	5.1	INP A, II	NP B		6
	5.2	RESET			6
	5.3	GATE			6
	5.4	LOC.INF	•		6
	5.5	MPI 1 / I	MPI 2		6
6	Outp	outs			6
	6.1		/ Output 2		6
	6.2	Active O	utputs		6
7	Prog	rammin	ng		6
			the programming	(	6
	7.2		g the main menus		7
	7.3	Entering	a sub-menu		7
			g the parameters		7
			g parameter values		7
			count values		7
	7.7		he programming		7
	7.8		ming menu		7
			Select language		7
			Setting the Basic Function		8
					8
			Tacho/Frequency meter	10	
	0		Timer	1 <sup>1</sup>	
8		ration	a de a disales de desires en encadas		
	8.1 8.2		g the display during operation he presets	1. 1.	
	0.2		Setting via front keys	1	_
			Teach Function	10	
			Teach-In with tracking preset		
	8.3			11	
	8.4		Parameters	10	
	0.4		Entry into the default setting	10	
			Selecting the parameter sets	10	
			Accepting the setting	10	6
		8.4.4	Parameter Set Table	11	7
9	Erro	r Messa	ge	17	7
		nections		1	
. •			nd Control Inputs	1	
			oltage and Outputs	i	
11		nical D		17	
•		General		1	
		Pulse Co		i	
			requency Meter	18	



	11.4 Timer 11.5 Signal and Control Inputs 11.6 Outputs 11.7 Supply Voltage	18 18 18
	11.8 Sensor Supply Voltage 11.9 Climatic Conditions	18 18
	11.10 EMC	18
	11.11 Device Safety	18
	11.12Mechanical Data	18
	11.13 Connections	19
12	Scope of Delivery	19
13	Ordering Codes	19
14	Frequencies (typical)	19
	14.1 Pulse Counter	19
	14.2 Frequency Meter	19
15	Input modes: Pulse counting	20
16	Input modes: Timing	22
17	Input modes: Frequency meter	23
18	Output operations	24
19	Help Texts	26
20	Dimensional Drawings	28



#### 1 Preface



Please read this instruction manual entirely and carefully before installation and start-up. Please observe all warnings and advice, both for your own safety and for general plant safety. If the device is not used in accordance with this instruction manual, then the intended protection can be impaired.

### 2 Safety instructions and Warnings



Please use the device only if its technical condition is perfect. It should be used only for its intended purpose. Please bear in mind safety aspects and potential dangers and adhere to the operating instructions at all times. Defective or damaged devices should be disconnected from the mains immediately and taken out of operation. The device shall not be opened. Use the repair service of the manufacturer. Only connect the device to the electricity networks provided to that purpose.

The safety of the system in which the device is integrated is the responsibility of the installer.

Disconnect all electricity networks prior to any installation or maintenance work

Use exclusively cables approved in your country and designed for your temperature and power ranges. Installation and service work shall be carried out exclusively by qualified personnel.

The device must compulsorily be protected with approved external fuses. The value of these fuses can be found in the technical information.



This symbol is used on the device to remind of the existence of dangers, which are referred to in this manual.

# 2.1 Use according to the intended purpose

The preset counter detects and measures pulses, times and frequencies up to max. 60 kHz and offers a wide variety of different operating modes. At the same time, the preset counter processes programmed presets. Use for any purpose over and beyond this will be deemed as not in accordance with its intended purpose and thus not complying with the requirements.

The application area for this device lies in industrial processes and controls, in the fields of manufacturing lines for the metal, wood, plastics, paper, glass, textile and other like industries. Overvoltages at the terminals of the device must be kept within the limits of over-voltage Category II.

The device must only be operated when mounted in a panel in the correct way and in accordance with the section "Technical Data".

The device is not suitable for use in hazardous areas and for areas excluded in EN 61010 Part 1. If the device is used to monitor machines or processes in which, in the event of a failure of the device or an error made by the operator, there might be the risk of damaging the machine or causing an accident to the operators, it is your responsibility to take the appropriate safety measures.

The device has been designed for indoor operation. It may nevertheless be used outdoors, provided the technical data is adhered to. In this case, take care to provide suitable UV protection.

# 2.2 Mounting in a control panel



Mount the device away from heat sources and avoid direct contact with corrosive liquids, hot steam or similar.

Provide a free space of 10mm all around the device for its ventilation.

The device should be mounted so that the terminals are out of the reach of the operator and cannot be touched by him. When mounting the device, consider the fact that only the front side is classified as accessible for the operator.

#### Mounting instructions

correctly seated.

- Remove the mounting clip from the device.
- Insert the device from the front into the panel cut-out, ensuring the front-panel gasket is
- Slide the fixing clip from the rear onto the housing, until the spring clamps are under tension and the upper and lower latching lugs have snapped into place.

Note: In case of proper installation, IP65 can be reached on the front side.





### 2.3 Electrical Installation



The device must be disconnected from any power supply prior to any installation or maintenance work. Make sure that no more voltages LIABLE TO CAUSE AN ELECTROCUTION are present.

AC-powered devices must only be connected to the low-voltage network via a switch or circuit breaker installed close to the device and marked as their disconnecting device.

Installation or maintenance work must only be carried out by qualified personnel and in compliance with the applicable national and international standards.

Take care to separate all extra-low voltages entering or exiting the device from hazardous electrical conductors by means of a double or reinforced insulation (SELV circuits).



The device must be protected externally for its proper operation. Information about the prescribed fuses can be found in the technical information.

The relay outputs are not protected internally in the device. Without suitable protection of the relay outputs, undesired heat development or even fire may occur. The relay outputs must be protected externally by the manufacturer of the plant. It must also be made sure that, even in case of a malfunction, the values stated in the technical data are under no circumstances exceeded.

- During installation, make sure that the supply voltage and the wiring of the output contacts are both fed from the same mains phase, in order not to exceed the maximum permitted voltage of 250V.
- The cables and their insulation must be designed for the planned temperature and voltage ranges.
   Regarding the type of the cables, adhere to the applicable standards of the country and of the plant. The cross sections allowed for the screw terminals can be found in the technical data.
- Before starting the device, check the cables for proper wiring and tightening. The screws of

- unused screw terminals must be screwed to the stop, so that they cannot loosen and get lost.
- The device has been designed for overvoltage category II. If higher transient voltages cannot be excluded, additional protection measures must be taken in order to limit the overvoltage to the values of CAT II.

#### Advice on noise immunity

All connections are protected against external sources of interference. The installation location should be chosen so that inductive or capacitive interference does not affect the device or its connecting lines! Interference (e.g. from switch-mode power supplies, motors, clocked controllers or contactors) can be reduced by means of appropriate cable routing and wiring.

#### Measures to be taken:

Use only shielded cable and control lines. Connect shield at both ends. The conductor cross-section of the cables should be a minimum of 0.14 mm². The shield connection to the equipotential bonding should be as short as possible and with a contact area as large as possible (low-impedance). Only connect the shields to the control panel, if the latter is also earthed.

Install the device as far away as possible from noise-containing cables.

noise-containing cables.

Avoid routing signal or control cables parallel to power lines.

### 2.4 Cleaning and maintenance

The front side of the unit should only be cleaned using a soft damp (water!) cloth. Cleaning of the embedded rear side is not planned and is the responsibility of the service personnel or of the installer.

In normal operation, this device is maintenancefree. Should the device nevertheless not operate properly, it must be sent back to the manufacturer or to the supplier. Opening and repairing the device by the user is not allowed and can adversely affect the original protection level.

## 3 Description

6-digit 14-segment LED display, 14 mm Help Text display

Preset counter with two relay outputs

Preset entry via the front keys or via the Teach-In function

Step or tracking preset

Pulse counter, Frequency meter, Timer or Hour

Preset-, Batch- or Total counter Set function for pulse counter and timer





Multiplication and division factor

Averaging and Start Delay for frequency meter

Pulse counter: cnt.dir, up.dn, up.up, quad, quad2, guad4, A/B, (A-B)/Ax100%

Frequency meter: A, A - B, A + B, quad, A/B, (A-B)/Ax100%

Timer: FrErun, Auto, InpA.InpB. InpB.InpB Output operations:

Add, Sub, AddAr, SubAr, AddBat, SubBat, AddTot, SubTot, Trail, TrailAr


4-stage RESET mode

3-stage keypad locking (Lock)

MPI input for Display Latch, Teach-In or Set function

Supply voltage 100 ... 240 V AC ±10% or 10 ... 30 VDC

#### 4 Display/Operating elements

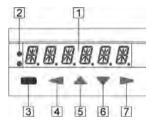

6-digit LED display

2 Status display LED1 / LED2

RESET key / ENTER key 3

4 Key LEFT

5 Key UP

Key DOWN 6 7 Kev RIGHT

#### 5 Inputs

#### 5.1 INP A. INP B

Signal inputs: function acc. to operating mode. Max. frequency 60 kHz, can be damped in the programming menu to 30 Hz.

Pulse counter: Frequency meter:

Timer:

Count inputs Frequency inputs Start input or Start/Stop inputs

#### 52 RESET

Dynamic reset input: resets the pulse counter or timer to zero ('Add' output operations) or to preset value 2 ('Sub' output operations). The reset input can be inhibited in the programming menu.

Pulse counter: RESET input Frequency meter: no function RESET input Timer:

#### 5.3 GATE

Static gate input: function dependent on operating mode

Pulse counter: no counting while active Frequency meter: no counting while active Timer: no time measurement while

active

#### 5.4 LOC.INP

Static keypad lock input for preset or programming. Lock-out level can be set in the programming menu

#### 55 MPI 1 / MPI 2

User Input. Programmable as Display Latch, Set or Teach-In input.

### Outputs

#### 6.1 Output 1 / Output 2

Relays with potential-free changeover contacts.

#### 6.2 Active Outputs

LED1 and LED2 indicate an active output. For safety switching the relays can be inverted, i.e. the relays will be de-energized when the presets are reached. To do this, the parameters Pr.OUT1 and Pr. OUT2 must be set to \_\_\_\_ (for permanent signal) and to \_\_\_\_ or \_\_\_ of (for timed signal).

#### 7 Programming

#### 7.1 Entering the programming

Simultaneously press the UP key - AVID and the DOWN key for 3 sec. The security prompt appears

PROG alternately in the display

Programming can be exited

-davoagain using the ENTER key. Press the UP key or DOWN key 



to continue with the programming.



1 F. 5

The security prompt YES appears in the display

M NOVO-LAUGU Enter the main menu by pressing the ENTER key



The first menu item in the main menu appears in the display



When ending the programming via PROG. NO the counter contents are not reset.

#### 72 Selecting the main menus



The main menus are selected using the UP and DOWN keys



Indicated by LED1

#### 7.3 Entering a sub-menu



Press the ENTER key. The first parameter is displayed with the current setting flashing. Indicated by LED1 and

# IN

### I FD2 7.4 Selecting the parameters



The parameters are selected using either the RIGHT key or the LEFT kev.

#### 7.5 Changing parameter values



Press the ENTER key.

Change the parameter value using the UP or DOWN keys.



Press the ENTER key. The new setting is again displayed flashing.

#### 7.6 Setting count values Press the ENTER key.





Select the decade using the RIGHT key or the LEFT key.



decade flashes



Change the count value using the UP key or the DOWN key.

Press the ENTER key. The new setting is again displayed flashing.

#### 7.7 Ending the programming

FURPEG MO

Select the menu item Pressing the ENTER key



acknowledges this prompt and allows the programming to be repeated. The previouslyprogrammed values are preserved. These can now be checked or changed once again.



Pressing the UP key or the DOWN key selects the termination of the programming.



The security prompt YES appears in the display



Pressing the ENTER key acknowledges this prompt and terminates the programming; the modified settings are saved in the EEPROM.



The text SAVE is shown in the display for 2 sec.



When ending the programme via END PRG. YES the counter contents are reset

No count pulses, frequencies or times are detected or measured whilst programming is taking place.

#### 7.8 Programming menu



Factory settings are highlighted in grey

# 7.8.1 Select language

LANGU Submenu: Select language Help Text



Help Text ON

Help Text OFF



Select language for Help Text Totalising [A + B] 511 ANG HPHP INP A: count input add English INP B: count input add German (Deutsch) Quadrature input DUAT INP A: count input 0° When 'Help Text ON' is selected, a INP B: count input 90° running text in English or German DUBLE Quadrature with pulse automatically appears after 3 sec. in the doubling (x2) display. This provides an explanation of INP A: count input 0° the menu item. Once a running text has started, it can be cancelled by pressing INP B: count input 90° Each pulse edge of INP A will be anv kev. counted 7.8.2 Setting the Basic Function DURIN Quadrature x4 FUNET Submenu: Basic function INP A: count input 0° INP B: count input 90° Each pulse edge of INP A and FUNET **Basic Function** INP B will be counted. Pulse counter (7.8.3) EDINI A- B Ratio measurement [A / B] TIMER Timer/Hour meter INP A: count input A INP B: count input B (7.8.5)80 08 Percentage differential Tacho/Frequency meter (7.8.4) TRCHO counting [(A - B) / A in %] Changing the basic function causes all INP A: count input A parameters to be reset to factory settings. INP B: count input B 7.8.3 Pulse Counter MPINET User input 1 7.8.3.1 Submenu for the Signal and Control MPINEZ User input 2 inputs Submenu for programming the INPUT LBICH When the MPI input is activated signal and control inputs the display is "frozen" and remains "frozen" until the MPI TUPPOI Input polarity input is deactivated. Internally the preset counter PMP PNP: switching to Plus continues counting. for all inputs in common TEACH When the MPI input is activated the current count value for the NPN NPN: switching to 0 V preset that has just been for all inputs in common selected will be adopted as the new preset value. FILTER Filter for signal inputs INP A (See also 8.2.2) and INP B SET When the MPI input is activated DEF Maximum count frequency the preset counter will be set to BNDamped to approx, 30 Hz the value specified in the (for control with mechanical parameter SETPT. (See also 8.3) contacts) CULINE Count Input mode LOCINE Lock input (See also under 15.) PROG When the Lock input is activated, CHIDIR Count/Direction control the programming is inhibited.



UPAN

INP A: count input

INP B: count direction input

INP A: count input add INP B: count input sub

Differential counting [A - B]



PRESET

When the Lock input is activated.

the setting of the preset values is

inhibited

PREPRE

When the Lock input is activated. the setting of the preset values and the programming are both inhibited

7.8.3.2 Submenu for Output operations

MADE

Submenu for determining the operation of the outputs

MARE

Output operation (See also under 18.)

ATT

Count mode ADDING

5118

Outputs active when count status > preset value Reset to zero Count mode SUBTRACTING

Output 1 active when count status ≤ preset value 1

Output 2 active when count status < 0 Reset to preset 2

RILAR

Count mode ADDING with automatic reset

Output 1 active when count status > preset value 1 Output 2 (timed signal) active when count status = preset value

Automatic reset to zero when count status = preset value 2 Reset to zero

SURRE

Count mode SUBTRACTING

with automatic reset Output 1 active when count

status < preset value 1 Output 2 (timed signal) active when count status = 0 Automatic reset to preset 2 when count status = 0

Reset to preset 2

ADBRAI

Count mode ADDING with automatic reset and Batch counter

Output 2 (timed signal) active when main counter = preset value 2

Automatic reset to zero when main counter = preset 2 Batch counter counts the number of automatic repetitions of preset

Output 1 active when Batch counter > preset 1 Manual reset sets both counters

to zero.

Electrical reset sets only the main counter to zero.

SUZZAI

Count mode SUBTRACTING with automatic reset and Batch counter

Output 2 (timed signal) active when main counter = zero Automatic reset to preset 2 when main counter = zero Batch counter counts the number

of automatic repetitions of preset Output 1 active when Batch counter > preset 1 Manual reset sets main counter to preset value 2 batch counter to

zero Electrical reset only sets the main counter to preset value 2

RIBIOI

Count mode ADDING with automatic reset and Total counter

Output 2 (timed signal) active when main counter = preset Automatic reset to zero when

main counter = preset value 2 Total counter counts all the count pulses from the main counter Output 1 active when total counter > preset value 1 Manual Reset sets both counters

to zero Electrical reset sets only the

main counter to zero

503101

Count mode SUBTRACTING with automatic reset and Total counter

Output 2 (timed signal) active when main counter = zero Automatic reset to preset value 2 when main counter = zero Total counter counts (sub from preset value 1) all count pulses from main counter Output 1 active when Total

counter ≤ zero Manual reset sets both counters

to the preset values Electrical reset sets only main counter to preset value 2

Tracking Preset mode TRAIL

When preset 2 is changed then preset 1 automatically tracks it. Reset to zero

Preset 1 relative to Preset 2

TRAR

Tracking Preset mode with automatic reset



Dago Q I ENG

When preset 2 is changed then preset 1 automatically tracks it. Reset to zero. Automatic reset to zero when main counter = preset value 2. Preset 1 relative to Preset 2

7.8.3.3 Submenu for configuration

Submenu for matching the input pulses to the display.

FRETOR O LODOO

# Multiplication factor

can be programmed from 00.0001 to 99.9999 The setting 00.0000 will not be accepted.

DI 1 150 0 10000

#### Division factor

can be programmed from 01.0000 to 99.9999
A setting < 01.0000 will not be accepted.



### Decimal point setting

(only optical function)
0 no decimal place
0.0 1 decimal place
0.00 2 decimal places
0.000 3 decimal places
0.0000 4 decimal places
0.00000 5 decimal places



#### Set value

Set value can be programmed from -999999 to 999999 A previously programmed decimal point will be displayed

#### 7.8.3.4 Submenu for reset mode

Submenu for setting the reset mode



#### Reset mode

Manual reset (reset key) and electrical reset (reset input)



No reset possible (reset key and reset input inhibited)



Only electrical reset possible (reset input)

NANRES

Only manual reset possible

(reset kev)



#### Electrical Reset:

Always resets only the main counter.

### Manual Reset:

Resets the main counter (ACTUAL) and auxiliary counters (BATCH or TOTAL), if the value of the main counter or the value of an auxiliary counters is shown on the display.

### 7.8.3.5 Preset 1

see below 7.9.5.5

# 7.8.3.6 Preset 2

see below 7.9.5.6

### 7.8.4 Tacho/Frequency meter

#### 7.8.4.1 Submenu for the Signal and Control inputs

Submenu for programming the signal and control inputs

IIIP.PIIL Input polarity

PNP: switching to Plus

for all inputs in common

NPN: switching to 0 V
for all inputs in common

FILTER Filter for signal inputs INP A and INP B

maximum count frequency
Damped to approx. 30 Hz
(for control with mechanical

contacts)

Input mode Frequency measurement

(see also under 17.)
Simple frequency
measurement

INP A: Frequency input INP B: no function

INP A: Frequency input A INP B: Frequency input B

Total measurement [A + B]
INP A: Frequency input A

INP B: Frequency input B

Frequency measurement with direction detection [Quad]

INP A: Frequency input 0° INP B: Frequency input 90°

Ratio measurement [A / B]



Decimal point setting INP A: Frequency input A INP B: Frequency input B (determines the resolution) no decimal place 80 08 Percentage differential n n 1 decimal place measurement [(A-B) / A in %] 0.00 2 decimal places INP A: Frequency input A 0.000 3 decimal places INP B: Frequency input B AL G Moving average MPINET User input 1 DEF Moving average calculated MPINER AVG 2 over 2 measurements User input 2 AVG 5 over 5 measurements AVG 10 over 10 measurements LBICH When the MPI input is activated AVG 20 over 20 measurements the display is "frozen" and remains "frozen" until the MPI START Start delay input is deactivated. BBB Programmable from 00.0 up to Internally the frequency meter 99 9 sec continués runnina At the start of a measurement the (Display store). measurement results within this TEACH time-period are ignored. When the MPI input is activated the current frequency for the HRIT B Waiting time preset that has just been selected will be adopted as the Programmable from 00.1 up to new preset value. 99.9 sec. (See also 8.2.2) This value specifies how much time should elapse, after the last valid edge, before zero is to be LUCINE Lock input displayed. PROG When the Lock input is activated 7.8.4.3 Preset 1 the programming is inhibited See below 7 9 5 5 PRESET When the Lock input is activated the setting of the preset values is 7.8.4.4 Preset 2 inhibited. See below 7.9.5.6 PREPRE When the Lock input is activated the setting of the preset values 7.8.5 Timer and the programming are both inhibited 7.8.5.1 Submenu for the Signal and Control inputs 7.8.4.2 Submenu for configuration IMPUT Submenu for programming the EDNETE Submenu for matching the input signal and control inputs pulses to the display. FRETOR Multiplication factor IMPPOL. Input polarity 0 (0000 can be programmed from PMP PNP: switching to Plus 00.0001 to 99.9999 . The setting for all inputs in common 00.0000 will not be accepted NPN NPN: switching to 0 V 014 ISC 0 (0000 Division factor for all inputs in common can be programmed from 01.0000 to 99.9999 A setting < 01.0000 will not be Filter for signal inputs INP A FILTER





and INP B

for electronic control of the signal inputs

for mechanical control of the signal inputs (for control with

mechanical contacts)

DFF

BM

IMDBE

5F [ - 1

MIN- I

accepted.

Display mode

Calculation and display of the frequency / speed in 1/sec

Calculation and display of the

frequency / speed in 1/min

START Input mode Time measurement 7.8.5.2 Submenu for output operations (see also under 16.) MARE Submenu for determining the INRINE Start: Edge to INP A operation of the outputs Stop: Edge to INP B MADE Output operation INBINB Start: 1. Edge to INP B (See also under 18.) Stop: 2. Edge to INP B ATI Count mode ADDING FRERUN Timing can only be controlled via Outputs active when count status the Gate input, INP A and INP B > preset value have no function Reset to zero BUID Count mode SUBTRACTING The timer is reset by means of a 5118 RESET (to zero when adding, to Output 1 active when preset 2 when subtracting) and count status < preset value 1 then starts timing again. Timing Output 2 active when is stopped with adding count status < 0 operations when preset 2 is Reset to preset 2 reached. Timing is stopped with Count mode ADDING with RITAR subtracting operations when zero automatic reset is reached. A RESET during the Output 1 active when count timing process also causes this status > preset value 1 to stop. Output 2 (timed signal) active INP A and INP B: no function. when count status = preset value With AUTO: no output operations with Automatic reset to zero when automatic repeat. count status = preset value 2 MPINET User input 1 Reset to zero MPIMPZ SURRE Count mode SUBTRACTING User input 2 with automatic reset LBICH When the MPI input is activated Output 1 active when count the display is "frozen" and status < preset value 1 remains "frozen" until the MPI Output 2 (timed signal) active input is deactivated. when count status = 0 Internally the preset timer Automatic reset to preset 2 when continues counting. count status = 0 Reset to preset 2 TEACH When the MPI input is activated the current count value for the ADBRAI Count mode ADDING with preset that has just been automatic reset and Batch selected will be adopted as the counter new preset value. Output 2 (timed signal) active (See also under 8.2.2) when main counter = preset value 2 SET When the MPI input is activated Automatic reset to zero when the preset counter will be set to main counter = preset 2 the value specified in the Batch counter counts the number parameter SETPT. (See also of automatic repetitions of preset under 8.3) Output 1 active when Batch LUCINE Lock input counter > preset 1 PROG Manual reset sets both counters When the Lock input is activated the programming is inhibited to zero Electrical reset sets only the PRESET When the Lock input is activated main counter to zero. the setting of the preset values is SURBAL Count mode SUBTRACTING inhibited. with automatic reset and Batch counter PREPRE When the Lock input is activated Output 2 (timed signal) active the setting of the preset values when main counter = zero and the programming is both



Automatic reset to preset 2 when

inhibited.

main counter = zero Batch counter counts the number of automatic repetitions of preset

Output 1 active when batch counter > Preset 1

Manual reset sets main counter to preset value 2 and batch counter to zero

Electronic reset only sets the main counter to preset value 2

# RIBIAL

#### Count mode ADDING with automatic reset and Total counter

Output 2 (timed signal) active when main counter = preset value 2

Automatic reset to zero when main counter = preset value 2 Total counter counts all the count pulses from the main counter Output 1 active when total counter > preset value 1 Manual Reset sets both counters

Electrical reset sets only the main counter to zero

# 503101

#### Count mode SUBTRACTING with automatic reset and Total counter

Output 2 (timed signal) active when main counter = zero Automatic reset to preset value 2 when main counter = zero Total counter counts (sub from preset value 1) all count pulses from main counter Output 1 active when Total counter < zero

Manual reset sets both counters to the preset values Electrical reset sets only main counter to preset value 2

# TRAIL

#### Tracking Preset mode

When preset 2 is changed then preset 1 automatically tracks it. Reset to zero

Preset 1 relative to Preset 2

# TRAR

#### Tracking Preset mode with automatic reset

When preset 2 is changed then preset 1 automatically tracks it. . Reset to zero.

Automatic reset to zero when

main counter = preset value 2. Preset 1 relative to Preset 2

### 7.8.5.3 Submenu for configuration

FOREIG Submenu for matching the input pulses to the display.

THORE Unit of time SEC

Seconde

Decimal point setting determines the resolution

MIM Minutes Decimal point setting determines the resolution

HOUR Hours Decimal point setting determines the resolution

HHHMSS Hre Min Sec

Decimal point setting (determines the resolution) no decimal place

n n 1 decimal place 0.00 2 decimal places 0.000 3 decimal places

SEIPT плапапа

## Set value

Set value can be programmed from 000000 to 999999 A previously programmed decimal point will be displayed

#### 7.8.5.4 Submenu for reset mode

PESMOT Submenu for setting the reset mode Reset mode

PESMOI MANEL

Manual reset (reset key) and electrical reset (reset input)

NORES. No reset possible (reset key and reset input

inhibited) Only manual reset possible

FLRES (reset key)

MRNRESOnly manual reset possible (reset kev)



Always resets only the main counter.

### Manual Reset:

Resets the main counter (ACTUAL) and auxiliary counters (BATCH or TOTAL), if the value of the main counter or the value of an auxiliary counters is shown on the display.





#### 7.8.5.5 Submenu for Preset 1

PRES / Submenu Preset 1

PRESI

### Preset 1 ON/OFF

Preset 1 ON

Preset 1 OFF and no function

PROUT L

### Output signal

ADD mode output operations: permanent signal at Output 1, becomes active when count ≥ Preset 1 SUB mode output operations: permanent signal at Output 1, becomes active when count ≤ Preset 1

L

-T7--

ADD mode output operations: permanent signal at Output 1, becomes passive when count ≥ Preset 1
SUB mode output operations: permanent signal at Output 1, becomes passive when count <

Preset 1

ADD mode output operations: timed signal at Output 1, becomes active when count ≥ Preset 1. (Activation only in positive direction) SUB mode output operations: timed output at Output 1, becomes active when count ≤ Preset 1 (Activation only in negative direction)

--11--

timed signal at Output 1, becomes passive when count ≥ Preset 1. (Deactivation only in positive direction) SUB mode output operations: timed output at Output 1, becomes passive when count ≤ Preset 1. (Deactivation only in negative direction)

ADD mode output operations:

ADD mode output operations:

-11--11-

timed signal at Output1, becomes active with positive direction and when count ≥ Preset 1 and subsequently active with negative direction and when count ≤ Preset 1 SUB mode output operations: timed signal at Output 1.

SUB mode output operations: timed signal at Output 1, becomes active with negative direction and when count < Preset 1 and subsequently active

with positive direction and when count ≥ Preset 1

ADD mode output operations:

U

timed signal at Output1, becomes passive with positive direction and when count ≥ Preset 1 and subsequently passive with negative direction and when count ≤ Preset 1 SUB mode output operations: timed output at Output 1, becomes passive with negative direction and when count ≤ Preset 1 and subsequently passive with positive direction and when count > Preset 1

I.IIII I

Duration of timed signal of Output 1

99. Tin

programmable from 00.01 to 99.99 sec. Timed signal is post-triggered

# 7.8.5.6 Submenu for Preset 2

PRIUTE Output signal

ADD mode output operations: permanent signal at Output 2, becomes active when count ≥ Preset 2 SUB mode output operations: permanent signal at Output 2,

permanent signal at Output 2, becomes active when count < zero

ADD mode output operations: permanent signal at Output 2, becomes passive when count ≥ Preset 2

SUB mode output operations: permanent signal at Output 2, becomes passive when count 
zero

-- [7--

ADD mode output operations: timed signal at Output 2, becomes active when count ≥ Preset 2 (Activation only in positive direction). SUB mode output operations: timed signal at Output 2, becomes active when count ≤ zero (Activation only in negative

direction)

-- 17--

ADD mode output operations: timed signal at Output 2, becomes passive when count ≥ Preset 2 (Deactivation only in positive direction) SUB mode output operations: timed signal at Output 2,

becomes passive when count < zero (Deactivation only in negative direction).

 $\Pi_{-}\Pi_{-}$ 

ADD mode output operations: timed signal at Output 2. becomes active with positive direction and when count > Preset 2 and subsequently with negative direction and when count < Preset 2 SUB mode output operations: timed signal at Output 2, becomes active with negative direction and when count < zero and subsequently with positive direction and when count > zero

ADD mode output operations: timed signal at Output 2. becomes passive with positive direction and when count > Preset 2 and subsequently with negative direction and when count < Preset 2 SUB mode output operations: timed signal at Output 2, becomes passive with negative direction and when count < zero and subsequently with positive direction and when count > zero

# TUUTE

#### Duration of timed signal of Output 2

000 1

programmable from 00.01 to 99 99 sec

Timed signal is post-triggered



Relays are activated when the preset value is reached. Passive:

Relays becomes de-energized when the preset value is reached.

Timed outputs that have started are not aborted by a RESET.

### Operation

#### 8.1 Switching the display during operation



t = 2 sec



Pressing the DOWN key or the UP key once causes the name of the currently selected display function to be displayed for 2 sec. If within this time the DOWN key or the UP key is pressed a second time, then the display switches to the next or previous display function. This is confirmed by displaying the new name for a period of 2 sec. After 2 sec the count value that corresponds to the selected display function is displayed.



Main counter Batch counter Total counter

Preset 1 Preset 2

#### 8.2 Setting the presets

# 8.2.1 Setting via front kevs

Using the UP key or the DOWN key, select the preset to be changed, either PRES1 or PRES2 (see 8.1).



Select the decade using the RIGHT key or the LEFT key.



the corresponding decade flashes



Set the count value using the UP key or the DOWN key.

The new setting is accepted either by pressing the ENTER key or after a period of 2 sec.



Preset setting is inhibited if the lock function for the presets is active (Parameter LOC.INP set to PRESET or PRG.PRE and keypad lock input LOCK active).





#### 8.2.2 Teach Function

- In the programming menu, programme MPI input 1 or MPI input 2 (MP.INP.1 / MP.INP.2) to TFACH
- In operating mode, select the preset to be changed: PRES1 or PRES2
- In operating mode, briefly activate MPI input 1 or MPI input 2 (NPN or PNP input logic)
  - the current count value will be adopted as the new preset value



See also 9. Error messages.

The preset value can subsequently be further modified via the keypad. If preset entry is inhibited (see note 8.2.1), then the Teach Function is also locked out

### 8.2.3 Teach-In with tracking presets

If a tracking (trailing) preset (TRAIL or TR.AR) has been programmed, the value for Preset 2 can be set either via the keypad or via the Teach-In function

However the value for Preset 1 must be entered via the keypad. In this instance, it is not possible to use the Teach-In function.



With output operations ADD.BAT, SUB.BAT, ADD.TOT, SUB.TOT, TRAIL and TR.AR, the Teach-In function is not available for Preset 1.

#### 8.3 Set Function

The pulse counter and the timer can be set to a value by means of the Set function.

- In the programming menu, programme MPI Input 1 or MPI Input 2 (MP.INP1 / MP.INP2) to SET
- In the programming menu, set the parameter SETPT to the desired value
- In operating mode, briefly activate MPI input 1 or MPI input 2 (NPN or PNP input logic)
  - For add. output operations the pulse counter or timer will be set to the SETPT value
  - For sub. output operations the pulse counter or timer will be set to the difference between the value of Preset 2 and the value of SETPT



See also 9. Error messages

#### 8.4 Default Parameters



Note: Three default parameter sets have been permanently stored; these can be adapted as required. With each acknowledgment of the parameter sets, all parameters will be reset to the values listed in the table.

### 8.4.1 Entry into the default setting

□◄△▽►

Simultaneously press the UP key and the DOWN key for 3 sec.

IEFAUL. NO The security prompt appears in the display



Programming can be exited again using the ENTER key.



Press the UP key or the DOWN key to continue with the programming.



The security prompt YES appears in the display



Enter the default menu by pressing the ENTER key



The parameter set last programmed appears in the display

### 8.4.2 Selecting the parameter sets



The parameter sets are selected using the UP key and the DOWN key.



Default parameter set 1
Default parameter set 2
Default parameter set 3

# 8.4.3 Accepting the setting

 $\blacksquare \triangleleft \triangledown \land \lozenge$ 

Pressing the ENTER key accepts the current setting and returns to the operating mode.



The text SAVE is shown in the display for 2 sec.



## 8.4.4 Parameter Set Table


	P.SET1	P.SET2	P.SET3
HLP.TXT.	ON	ON	ON
SL.LANG.	EN	EN	EN
FUNCT	COUNT	COUNT	COUNT
INP.POL.	PNP	PNP	PNP
FILTER	ON	OFF	OFF
COUNT	CNT.DIR	UP.DN	QUAD
MP.INP.1	LATCH	LATCH	SET
MP.INP.2	TEACH	SET	TEACH
LOC.INP.	PROG	PROG	PROG
MODE	ADD	SUB	TRAIL
FACTOR	01.0000	01.0000	01.0000
DIVISO.	01.0000	01.0000	01.0000
DP	0	0	0.00
SETPT.	000000	000000	00.000
RES.MOD.	MAN.EL	MAN.EL	MAN.EL
PRES.1	ON	ON	ON
PR.OUT1			
T.OUT1		00.10	
PR.OUT2	4	4	4
T.OUT2		00.10	00.10

# **Error Message**

Err 1	Set value ≤ 0 not allowed
Err 2	Set value ≥ Preset 2 not allowed
Err 3	negative Teach-In value for Preset 1 not permitted
Err 4	Zero or negative Teach-In value for
	Preset 2 not permitted
F== 45	EEDDOM array

Err 45 EEPROM error

### 10 Connections

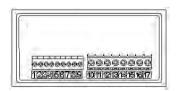

#### Signal and Control Inputs 10.1

N°	Designation	Function
1	INP A	Signal input A
2	INP B	Signal input B
3	RESET	Reset input
4	LOCK	Keypad lock
5	GATE	Gate input
6	MPI 1	User input 1
7	MPI 2	User input 2
8	AC: 24 VDC/80 mA DC: U <sub>B</sub> connected through	Sensor supply voltage
9	GND (0 VDC)	Common connection Signal and Control inputs

#### Supply Voltage and Outputs 10.2

N°	Designation	Function	
10	Relay contact C.2	Output 2	
11	Relay contact N.O.2		
12	Relay contact N.C.2		
13	Relay contact C.1		
14	Relay contact N.O.1	Output 1	
15	Relay contact N.C.1		
16	AC: 100240 V AC ±10% N~	Supply	
	DC: 1030 VDC	voltage	
17	AC: 100240 V AC ±10% L~	Supply	
	DC: GND (0 VDC)	voltage	

### 11 Technical Data

#### General Data 11.1

Display 6-digit, 14-segment LED Digit height 14 mm

Overload/

Blinking, 1 sec., counter loses Underload no pulses up to 1 decade Data retention > 10 years, EEPROM

Operation 5 keys

#### 11.2 **Pulse Counter**

Count frequency max. 55 kHz (see under 14. Frequencies - typical)

Response time of the outputs:

Add;Sub;Trail < 13 ms

With automatic repeat < 13 ms

A/B; (A-B)/A < 34 ms





#### 11.3 Tacho/Frequency Meter

Frequency range 0.01 Hz to 65 kHz (see under 14. Frequencies typ.

Measuring principle ≤ 76.3 Hz Time interval

> (Period measurement) > 76 3 Hz Gate time

> Gate time approx, 13.1 ms < 0.1% per channel

Measuring error Response time of the outputs:

1-channel operation < 100 ms @ 40 kHz < 350 ms @ 65 kHz 2-channel operation < 150 ms @ 40 kHz < 600 ms @ 65 kHz

#### 11.4 Timer

Seconds 0.001 sec 999 999 sec 0.001 min ... 999 999 min Minutes Hours 0.001 hrs ... 999 999 hrs Hrs Min Sec 00hrs.00min.01sec ... 99hrs.59min.59sec

Min. time measurable 500us Measuring error < 100 ppm Output response time: < 13 ms

# Signal and Control Inputs

SELV circuits, reinforced / double insulation Polarity: programmable NPN/PNP for all inputs in common

Input resistance 5 kO Pulse shape

Switching level with AC supply: HTL level 0 ... 4 VDC Low: 12 ... 30 VDC High:

4...30 V DC level 0 ... 2VDC Low: High: 3.5 ... 30 VDC

Switching level with DC supply: HTL level Low:

0 ... 0,2 x U<sub>B</sub> High: 0.6 x U<sub>B</sub> ... 30 VDC 4...30 V DC level 0 ... 2 VDC Low: High: 3.5 ... 30 VDC

Minimum pulse length of the Reset input: 1 ms Minimum pulse length of the Control inputs:10 ms

# Output 1 / Output 2

11.6

Relays with changeover contacts

Outputs

Prescribed fuse:

Switching voltage max, 250 V AC/ 150 V DC Switching current max. 3 A AC/ DC

min 30 mA DC Switching capacity max. 750 VA/ 90 W

The maximum values shall in no case be exceeded!

Mechanical service life (switching cycles) 20x106 N° of switching cycles at 3 A/ 250 V AC 5x104 N° of switching cycles at 3 A/ 30 V DC 5x104

#### 11.7 Supply Voltage

AC supply: 100 ... 240 V AC / max. 11 VA

50/60 Hz. Tolerance + 10% ext. fuse protection: T 0.1 A 10 ... 30 V DC/ max. 5.5 W

DC supply: reverse polarity protection, SELV. CLASS II (Limited

Power Source) ext. fuse protection T 0.25 A

#### 11.8 Sensor Supply Voltage

(Voltage output for external sensors) SELV circuits, reinforced / double insulation. for AC supply: 24 V DC ±15%, 80 mA for DC supply: max, 80 mA, ext, voltage supply is connected through

#### 119 Climatic Conditions

Operating temperature: -20°C ... +65°C Storage temperature: -25°C ... +75°C Relative humidity: R.H. 93% at +40°C. Non-condensing Altitude: up to 2000 m

#### 11.10 EMC

Noise immunity: FN 61000-6-2

with shielded signal and control cables Noise emission: EN 55011 Class B

### 11.11 Device Safety

Design to: EN 61010 Part 1

Protection Class: Protection Class 2 (front side)

Only the front side is classified as accessible for the operator.

Pollution level 2 Application area: over-voltage Category II Insulation: Front: double insulation.

Rear side: basic insulation, Signal inputs and und sensor power supply: SELV

#### 11.12 Mechanical Data

Housing: Panel-mount housing to DIN 43 700, RAL 7021

Dimensions: 96 x 48 x 102 mm 92+0,8 x 45+0,6 mm Panel cut-out:

Installation depth: ca. 92 mm incl. terminals Weiaht: ca. 180 a

Protection: IP65 (front, device only) Housing material: Polycarbonate UL94 V-2 Vibration resistance: 10 - 55 Hz / 1 mm / XYZ FN 60068-2-6 30 min, in each direction

Shock resistance: EN 60068-2-27 100G / 2 ms / XYZ

3 times in each direction EN 60068-2-29 10G / 6 ms / XYZ

2000 times in each direction





AddTot

### 11.13 Connections


Supply voltage and outputs: Plug-in screw terminal, 8-pin, RM 5.00 Core cross - section, max, 2.5 mm<sup>2</sup>

Signal and control inputs: Plug-in screw terminal, 9-pin, RM 3.50 Core cross - section, max, 1.5 mm<sup>2</sup>

### 12 Scope of Delivery

Preset counter Mounting clip Instruction manual

# 13 Ordering Codes

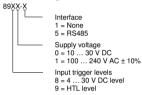

# 14 Frequencies (typical)

#### NOTE: Switching levels of the inputs

Switching levels with AC supply: 0 ...4 V DC HTL level Low: High: 12 ... 30 V DC 0 ... 2 V DC 4 ... 30 V DC level Low: 3.5 ... 30 V DC High:

Switching levels with DC supply:

HTL level Ó ... 0.2 x U<sub>B</sub> Low:

0.6 x U<sub>B</sub> ... 30 V DC High: 0 ... 2 V DC 4 ... 30 V DC level Low: High: 3.5 ... 30 V DC

#### 14.1 Pulse Counter

# .....

mil level, signal shape square wave iti		
AC supply	typ. Low	2.5 V
	typ. High	22 V
DC supply 12V	typ. Low	2 V
	typ. High	10 V
DC supply 24V	typ. Low	2.5 V
	typ. High	22 V

	Add Sub Trail	AddAr SubAr AddBat SubBat TrailAr	AddTot SubTot
Cnt.Dir	55 kHz	2.6 kHz	2.5 kHz
Up.Dn; Up.Up	29 kHz	2.6 kHz	2.5 kHz
Quad; Quad 2	28 kHz	1.2 kHz	1.1 kHz
Quad 4	18 kHz	1.1 kHz	0.8 kHz
A/B; (A-B)/A	29 kHz		

#### 4...30 V DC level, signal shape square wave 1:1 typ. Low 1.0 V

typ. High 4.0 V Add AddAr

	Sub Trail	SubAr AddBat SubBat TrailAr	SubTot
Cnt.Dir	9 kHz	2.5 kHz	2.2 kHz
Up.Dn ; Up.Up	9 kHz	2.5 kHz	2.2 kHz
Quad; Quad 2	9 kHz	1.1 kHz	1.1 kHz
Quad 4	9 kHz	1.1 kHz	0.9 kHz
A/B; (A-B)/A		9 kHz	

#### 14.2 Frequency Meter

### HTL level, signal shape square wave 1:1

AC supply	typ. Low	2.5 V
	typ. High	22 V
DC supply 12V	typ. Low	2 V
	typ. High	10 V
DC supply 24V	typ. Low	2.5 V
	typ. High	22 V

#### 4...30 V DC level, signal shape square wave 1:1 tvp. Low 1 0 V

4.0 V typ. High

	HTL	5V
Α	65 kHz	9 kHz
A – B ; A + B A / B ; (A-B)/A	65 kHz	9 kHz
Quad	30 kHz	9 kHz





# 15 Input modes: Pulse counting

Function	Diagram	PNP: Count on rising edge NPN: Count on falling edge
	Note: No counting when GATE input is active P = Preset	
CNT.DIR	INPA	Inp A: Count input Inp B: Count direction Add: Display 0> Preset Sub: Display Preset -> 0
UP.DN	INPA	Inp A: Count input add Inp B: Count input sub Add: Display 0> Preset Sub: Display Preset -> 0
UP.UP	INPR ADD 0 1 2 3 4 6 7	Inp A: Count input 1 add Inp B: Count input 2 add Add: Display 0> Preset
QUAD	INPA	A 90° B Inp A: Count input Count on one edge Inp B: Reverse direction Add: Display 0> Preset Sub: Display Preset -> 0
QUAD2	INPB	A 90° B Inp A: Count input Count on rising and on falling edges Inp B: Reverse direction Add: Display 0> Preset Sub: Display Preset -> 0

Function	Diagram	PNP: Count on rising edge NPN: Count on falling edge
	Note: No counting when GATE input is active	
QUAD4	INPB	A 90° B Inp A: Count input Count on rising and on falling edges Inp B: Count input Count on rising and on falling edges, Reverse direction Add: Display 0> Preset Sub: Display Preset -> 0
A/B	INPA Counts A 0 1 1 1 2 3 4  INPB Counts B 0 1 2 3 3 4 4  Display 0 1 0.5 0.33 0.66 0.75 1	Inp A: Count input 1 Inp B: Count input 2 Formula: A / B
A % B	INPA	Inp A: Count input 1 Inp B: Count input 2 Formula: (A – B)/A x100

# 16 Input modes: Timing

Function	Diagram	PNP: Count on rising edge NPN: Count on falling edge	
INA.INB	INP A	edge Inp A: Start Inp B: Stop Add: Display 0> Preset Sub: Display Preset -> 0	
INB.INB	ADD 0 71 71-172	Inp A: no function Inp B: Start/Stop Add: Display 0> Preset Sub: Display Preset -> 0	
FREE.RN	ADD 0 P-T1 P-T1-T2	Inp A: no function Inp B: no function Control of the timing only via the GATE input Add: Display 0> Preset Sub: Display Preset -> 0	
AUTO	GATE Off On Off  RESET	Inp A: no function Inp B: no function Control of the timing via RESET (manual or electrical) Add: Display 0 -> Preset Sub: Display Preset -> 0	




# 17 Input modes: Frequency meter

Function	Diagram	PNP: Count on rising edge NPN: Count on falling edge
A	INPA 0 F <sub>A0</sub> F <sub>A1</sub> F <sub>A2</sub> 0 × Display 0 0 F <sub>A0</sub> F <sub>A1</sub> F <sub>A2</sub> 0	Inp A: Frequency input Inp B: no function
A - B	INP A 0 FA0 FA1 FA2 0 X INP B 0 0 F90 F91 F92 X Display 0 0 FA0 FA0 FA0 FA1 F82	Inp A: Frequency input 1 Inp B: Frequency input 2 Formula: A - B
A + B	INP A 0 FAO FAO FAO X INP B 0 0 FBO FBO FBO X Display 0 0 FAO FAO FAO FBO FBO FBO FBO	Inp A: Frequency input 1 Inp B: Frequency input 2 Formula: A + B
QUAD	Inp A Inp B	A 90° B Inp A: Frequency input 1 Inp B: Reverse direction
A/B	INPA 0 F <sub>A0</sub> F <sub>A1</sub> 0 0 x INPB 0 0 F <sub>B0</sub> F <sub>B1</sub> F <sub>B2</sub> x Display 0 0 0 F <sub>A0</sub> F <sub>B0</sub> F <sub>A1</sub> /F <sub>B1</sub> 0	Inp A: Frequency input 1 Inp B: Frequency input 2 Formula: A / B
A % B	INP A 0 FAO FAO 0 0 × INP B 0 0 FBO FBO FBO FAO 0 Display 0 0 100% FAO%FBO FAO FBO 0	Inp A: Frequency input 1 Inp B: Frequency input 2 Formula: (A – B)/A x100

# 18 Output operations

Mode	Diagram	Mode	Diagram
	t Only in mode and		Additionally in mode  and  and
ADD	RESET COUNTER	SUB	RESET COUNTER COUTPY COUTFZ
ADD.AR	RESET DESCRIPTION OF PARTY OUT F2	SUB.AR	RESET DE COUNTER OUT FZ.
ADD.BAT	RESET SEZ COUNTER PRI SATCH SUT PI SU	SUB.BAT	PRISET PRIZE COUNTER PRI HATCH OUT PI OUT PZ
ADD.TOT	RESET TOTAL COUNTER OUT PO	SUB.TOT	RESET DPS2 GOODFIELD PS1 TOTAL GOT P1 OUT P0

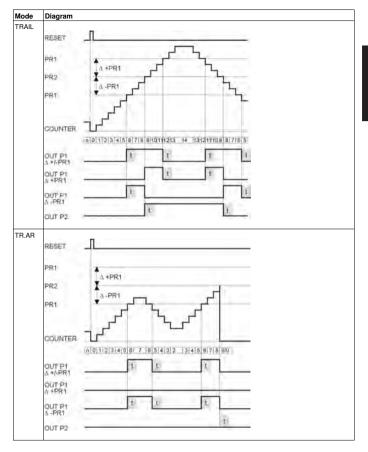



# 19 Help Texts

NO	NO PROGRAMMING
YES	START PROGRAMMING
	MAIN MENU SELECT LANGUAGE
YES	HELPTEXT ON
DE	DEUTSCH
	ENGLISH
	MAIN MENU BASIC FUNCTION
COLINT	BASIC FUNCTION COUNTER
	BASIC FUNCTION TIMER
	BASIC FUNCTION TACHOMETER/FREQUENCY METER
IAGIIO	MAIN MENU INPUTS
PNP	INPUT POLARITY PNP
	INPUT POLARITY NPN
	INPUT 30HZ FILTER OFF
	INPUT 30HZ FILTER ON
	INPUT MODE COUNT DIRECTION
	INPUT MODE UP-DOWN
	INPUT MODE UP-UP
	INPUT MODE QUADRATURE
	INPUT MODE QUADRATURE x 2
	INPUT MODE QUADRATURE x 4
	INPUT MODE A/B
	INPUT MODE (A-B)/A IN %
	START INPUT A / STOP INPUT B
	START INPUT B / STOP INPUT B
	TIMER IN FREE RUN MODE
	TIMER IN AUTO STOP MODE
	ONLY INPUT A
	INPUT MODE A-B
	INPUT MODE A+B
	INPUT MODE QUADRATURE
	INPUT MODE A/B
	INPUT MODE (A-B)/A IN %
	FUNCTION MP-INPUT LATCH
	FUNCTION MP-INPUT TEACH
SET	FUNCTION MP-INPUT SET
	LOCK PROGRAMMING
	LOCK EDITING OF PRESETS
	LOCK PROGRAMMING AND EDITING OF PRESETS
	MAIN MENU OPERATION MODE
ADD	MODE ADDING
	MODE ADDING WITH AUTOMATIC RESET
ADD.BAT	MODE ADDING WITH AUTOMATIC RESET + BATCH COUNTER
	MODE ADDING WITH AUTOMATIC RESET + TOTAL COUNTER
TRAIL	MODE ADDING OUTPUT 1 TRACKING PRESET OF OUTPUT 2
TR.AR	MODE ADDING OUTPUT 1 TRACKING PRESET OF OUTPUT 2 WITH AUTOMATIC RESET
SUB	MODE SUBTRACTING
THE COURT OF THE PARTY OF THE P	YES  YES  DE  EN  COUNT  TIMER  TACHO  PNP  NPN  OFF  ON  CNT.DIR  UP.DN  UP.DN  UP.DN  UP.DN  UP.DN  UP.DN  UP.DN  UP.DN  AAB  AAWB  INA.INB  FRE.RUN  AUTO  A  AA-B  QUAD  AAWB  AAWB  AAWB  NALITO  AA-B  AAWB  AATOH  AATOH  TEACH  TEACH




MODE S	SUB.AR	MODE SUBTRACTING WITH AUTOMATIC RESET
MODE S	SUB.BAT	MODE SUBTRACTING WITH AUTOMATIC RESET + BATCH COUNTER
MODE S	SUB.TOT	MODE SUBTRACTING WITH AUTOMATC RESET + TOTAL COUNTER
CONFIG.		MAIN MENU CONFIGURATION
FACTOR		MULTIPLICATION FACTOR
DIVISO.		DIVISION FACTOR
T.MODE S	SEC	TIME RANGE SECONDS
T.MODE N	MIN	TIME RANGE MINUTES
T.MODE H	HOUR	TIME RANGE HOURS
T.MODE H	HH.MM.SS	TIME RANGE HH.MM.SS
T.MODE S	SEC-1	TACHO RANGE SEC-1
T.MODE N	MIN-1	TACHO RANGE MIN-1
DP		DECIMAL POINT
SETPT.		SET VALUE
AVG (	OFF	NO AVERAGE
	AVG 2	AVERAGE OF 2 MEASUREMENTS
	AVG 5	AVERAGE OF 5 MEASUREMENTS
	AVG10	AVERAGE OF 10 MEASUREMENTS
	AVG20	AVERAGE OF 20 MEASUREMENTS
START		START DELAY TIME [SEC]
WAIT 0		WAIT TIME UNTIL DISPLAY ZERO (SEC)
RES.MOD		MAIN MENU RESET MODE
RES.MOD. N	NO.RES.	NO RESET FUNCTION
RES.MOD. N		RESET VIA FRONT BUTTON
RES.MOD. E		RESET VIA RESET INPUT
RES.MOD. N		RESET VIA FRONT BUTTON OR RESET INPUT
PRES. 1		MAIN MENU PRESET 1
	ON	PRESET 1 ON
	OFF	PRESET 1 OFF
PR.OUT1		PERMANENT SIGNAL FORM AT OUTPUT 1
		PERMANENT SIGNAL FORM AT OUTPUT 1
PR.OUT1		TIMED SIGNAL FORM IN MAIN DIRECTION AT OUTPUT 1
		TIMED SIGNAL FORM IN MAIN DIRECTION AT OUTPUT 1
PR.OUT1		TIMED SIGNAL FORM IN BOTH DIRECTION AT OUTPUT 1
		TIMED SIGNAL FORM IN BOTH DIRECTION AT OUTPUT 1
T.OUT 1		ACTIVE TIME FOR OUTPUT 1
PRES. 2		MAIN MENU PRESET 2
PR.OUT2		PERMANENT SIGNAL FORM AT OUTPUT 2
		PERMANENT SIGNAL FORM AT OUTPUT 2
PR.OUT2		TIMED SIGNAL FORM IN MAIN DIRECTION AT OUTPUT 2
		TIMED SIGNAL FORM IN MAIN DIRECTION AT OUTPUT 2
PR.OUT2		TIMED SIGNAL FORM IN BOTH DIRECTION AT OUTPUT 2
-		TIMED SIGNAL FORM IN BOTH DIRECTION AT OUTPUT 2
T.OUT 2		ACTIVE TIME FOR OUTPUT 2
1.0012	NO.	REPEAT PROGRAMMING
END DDG N		
END.PRG. N	YES	EXIT PROGRAMMING AND STORE DATAS







# 20 Dimensional Drawings

Dimensions in mm [inch]

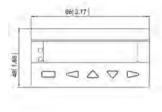

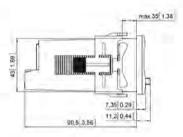

#### Rear view:

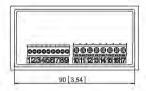

### Panel cut-out:

