VAISALA www.vaisala.com

# Vaisala HUMICAP® Hand-Held Humidity and Temperature Meter Series HM40



The Vaisala HM40 Humidity and Temperature Meter is designed for spot-checking in a wide variety of environments and is available with four different probe options. Left to right: HM41, HM45, HM42, and HM46.

The easy-to-use HM40 is a compact and portable humidity meter that provides reliable measurements in a wide range of applications. It is the ideal spot-checking tool for everything from structural moisture measurement and air conditioning systems to humidity measurement in industrial production processes and life science applications. There are four different models available: HM41, HM42, HM45, and HM46.

## Simple and Easy to Use


The HM40 has a large, user-friendly graphical display and easy-to-use push buttons. The user interface is simple and intuitive, and available in 10 languages. Also, many settings can be modified to meet users' individual needs. In addition to relative humidity and temperature, the HM40 provides five calculated humidity

parameters, all of which are available in metric and non-metric units.

The HM40 is powered by 2 AA batteries. An external NiMH charger with USB connection and rechargeable AA sized NiMH batteries are available as an option. Each model also comes with a handy belt clip and case.

## **Easy Recalibration**

Calibrating the HM40 is easy. The meter or the probe can be sent to a Vaisala Service Center for recalibration. Alternatively, calibration can be completed on site by users with a humidity reference such as another hand-held meter or the Vaisala Humidity Calibrator HMK15. The indicator includes a calibration reminder function that can be activated by the user.

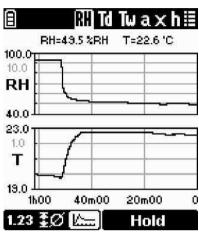

The graph clearly indicates when the readings have stabilized.

#### **Benefits**

- Compact, portable, and easy to use
- Versatile meter with wide measurement range and multiple calculated parameters
- Four different models available: HM41, HM42, HM45, and HM46
- Ideal for spot-checking in a wide variety of applications

#### **Features**

- Humidity measurement range 0 ... 100 %RH
- Temperature measurement ranges -40 ... +100 °C (-40 ... +212 °F), depending on probe model. The HM46 can measure up to +180 °C (+356 °F) for a short period of time.
- Incorporates proven Vaisala HUMICAP® sensor technology
- Calibration reminder function
- Probes can be user calibrated using an on-site reference
- Graphical display indicates when measurement has stabilized
- Hold-button to freeze the screen and save the reading
- Multilingual user interface available in 10 languages (EN, DE, FR, JA, ZH, PT, ES, RU, FI, SV)





#### **Technical Data**

#### **HM41 Humidity and Temperature Meter**

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH)

at -10 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +60 °C ±4.0 %RH (90 ... 100 %RH)

Temperature

measurement range -10 ... +60 °C interchangeable Measurement probe

HMP113 probe

Probe material PC/ABS plastic blend (white) Housing classification



### **Technical Data**

# HM42 Humidity and Temperature Meter for Tight Spaces

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH) at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH)

+40 ... +80 °C ±4.0 %RH (90 ...100 %RH) at +80 ...+100 °C ±4.0 %RH\*

Probe head temperature

-40 ... +100 °C measurement range Measurement probe HM42PROBE Stainless steel Probe head material

Housing classification IP40 (probe), IP54 (indicator)

<sup>\*)</sup> Not recommended for T<sub>d</sub> > 85 °C



#### **Technical Data**

#### **HM45 Humidity and Temperature Meter with Remote Probe**

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH)

±2.5 %RH (90 ... 100 %RH)

at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +60 °C ±4.0 %RH (90 ... 100 %RH)

Probe temperature

Housing classification

measurement range -40 ... +60 °C

Measurement probe interchangeable


HMP113 with HM40HANDLE

IP54


PC/ABS plastic blend (white) Probe material

#### **Dimensions**

Dimensions in mm

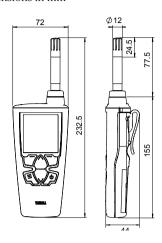


### **Dimensions**

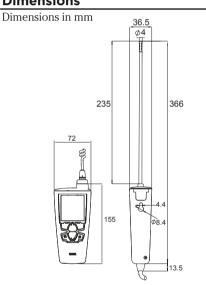

#### **Dimensions**

Dimensions in mm

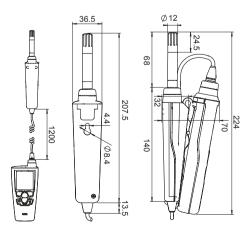




### **Technical Data**

#### **HM46 Humidity and Temperature** Meter for Mechanical Durability and **Extra Reach**

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH) at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +80 °C ±4.0 %RH (90 ... 100 %RH) at +80 ...+100 °C ±4.0 %RH\* -40 ... +100 °C, short-Probe head temperature measurement range term up to +180 °C Measurement probe HM46PROBE Probe head material Stainless steel, brass filter Housing classification IP40 (probe), IP54 (indicator)

\*) Not recommended for  $T_d > 85$  °C

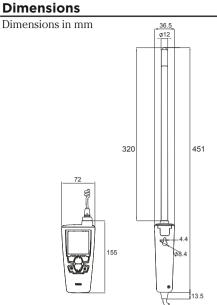

## **Technical Data**

Performance		
RELATIVE HUMIDITY		
Measurement range	0.	100 %RH
Accuracy (including non-linearity,		
hysteresis, and repeatability) for		
different models at 0 +40 °C	±1.5 %RH (0 90 %RH)	
(+32 +104 °F)	±2.5 %RH (90	100 %RH)
Factory calibration uncertainty at +	20 °C (+68 °F)	±1.5 %RH
Humidity measurement response ti	me	
(90 %) with plastic grid filter (HM41 and HM45)		17 s
(90 %) with membrane filter and steel grid (HM42)		26 s
(90 %) with brass sintered filter (	HM46)	40 s
Stability	±2 %RH o	ver 2 years
Humidity sensor		
HM41, HM45, HM46	HUMICAP® 180R	
HM42	HUMICAP®	100R-Mini
TEMPERATURE		
Measurement range		
HM41	-10 +60 °C (+14	+140 °F)
HM42	-40 +100 °C (-40	+212 °F)
HM45	-40 +60 °C (-40	+140 °F)
HM46	-40 +100 °C (-40 .	+212 °F),

#### **Mechanics**

i icciiaiiico		
Weight (with alkaline batteries		
HM41	230 g	
HM42	370 g	
HM45	330 g	
HM46	490 g	
Probe cable lengths		
HM42, HM46	1500 mm	
HM45	1200 mm	
Materials		
Meter body	PC/ABS blend, acrylic display lens	
Probe holder	PC/ABS blend (gray)	
Probe handle	PC/ABS blend (white),	
	PC/ABS blend (gray, HM45)	
	or PBT (gray, HM42/46)	
HMP113 probe or	PC/ABS blend (white, HM41/45)	
probe measurement head	or stainless steel (HM42/46)	
Filter		
HM41, HM45	PC (glass-reinforced)	
HM42	Stainless steel and PTFE membrane	
HM46	Sintered brass	
Housing classification	IP54	
HM42 and HM46 probes	IP40	



±0.2 °C (0.36 °F)

±0.4 °C (0.72 °F)

short-term up to +180 °C (+356 °F)

Pt1000 RTD Class F0.1 IEC 60751

Pt1000 RTD Class F0.3 IEC60751

HM42

Temperature sensor HM41, HM45, HM46

Accuracy over temperature range: at 0 ... +40 °C (+32 ... +104 °F)

at -40 ... 0 °C and +40 ... +100 °C (-40 ... +32 °F and +104 ... +212 °F)

## **Technical Data**

#### General

Power-up time <3s**Batteries**  $2 \times AA$ , 1.5 V Calculated parameters Dew point, wet bulb temperature, absolute humidity, mixing ratio, enthalpy Menu languages English, Chinese (simplified), Finnish, French, German, Japanese, Portuguese, Russian, Spanish, Swedish Display LCD (140 x 160 pixels) Operation time (typical) 100 hours (without backlight) Operation temperature range indicator -10 ... +60 °C (+14 ... +140 °F) probe handle -40 ... +60 °C (-40 ... +140 °F) probe head (see specifications for each probe type, ranges -40 ...+180 °C (-40 ... +356 °F) Storage temperature range -30 ... +70 °C (-22 ... +158 °F) Electromagnetic compatibility Complies with EMC standard EN61326-1, Portable Equipment

**Accessories and Spare Parts** 

INDICATOR	
Spare HM40 indicator	HM40INDI
Belt clip (3 pcs)	227710SP
Battery cover (3 pcs)	225688SP
NiMH rechargeable batteries (4 pcs)	229247SP
External battery recharger with USB	
connection and 4 batteries	229249SP
Case for short HM40 probes	235849SP
Case for long HM40 probes	DRW242351SP

STANDARD PROBE (HM41)		
HMP113 probe for HM40 HMP113 (configuration: V00B2C1A0)		
Plastic locking bushing (3 pcs) for attaching		
HMP113 probe to HM40 indicator	DRW238590SP	
Plastic grid filter for HMP113 probe	DRW236214SP	
Plastic grid with membrane filter for HMP113 probe	230727SP	
HM42 PROBE (HM42)		
Thin 4 mm diameter probe for HM40	HM42PROBE	
Steel grid filter for HM42PROBE	19867HM	
Membrane tube set (5 pcs) for HM42PROBE 19858HM		
Rubber sleeve set (10 pcs) for HM42PROBE	19809HM	
Calibration adapter for HM42PROBE	HM37067	
REMOTE PROBE (HM45)		
HMP113 probe for HM40 HMP113 (configuration	n: V00B2C1A0)	
Plastic locking bushing (3 pcs) for attaching		
HMP113 probe to HM40 indicator	DRW238590SP	
HM40 handle and cable	HM40HANDLE	
Plastic grid filter for HMP113 probe	DRW236214SP	
Plastic grid with membrane filter for HMP113 probe	230727SP	
HM46 PROBE (HM46)		

Stainless steel 12 mm diameter probe for HM40

Plastic grid filter for HM46PROBE (up to +80 °C)

Optional membrane filter for HM46PROBE

Sintered filter for HM46PROBE

Disposable sleeve, 50 pcs set

(up to +80 °C)

Probe holder



HM46PROBE

0195

6221

1558

10159HM

HM36915