



RESISTANCE METER RM3545/RM3544

Component measuring instruments





RESISTANCE METER RM3545

Featuring super-high accuracy and multi-channel capabilities

(20 channels with 4-terminal measurement)

■ Basic accuracy: 0.006% ■ No. of display digits: Max. 6.5

Max.resolution : $0.01\mu\Omega$ (LP) $0.01m\Omega$



RESISTANCE METER RM3544

High-accuracy bench-top meter ideal for production lines

Basic accuracy: 0.02% No. of display digits: Max. 4.5

Max.resolution : 1μΩ



Choose from two models based on your application



Super-high accuracy and multi-channel capabilities

for advanced development and production applications

Resistance measurement

Basic accuracy: 0.006%

Max. resolution : $0.01\mu\Omega$

Max. measurable current : 1A

•Low power resistance measurement

 $\label{eq:max_problem} \mbox{Basic accuracy}: \mbox{\bf 0.2\%} & \mbox{Max. resolution}: \mbox{\bf 0.01m} \mbox{\bf \Omega} \\ \mbox{Max. measurable current}: \mbox{\bf 1mA} & \mbox{Max. Open-circuit voltage}: \mbox{\bf 20mV} \\ \mbox{} \end{array}$



High-precision bench-top meter

for both manual operation and integration with automatic lines

Basic accuracy : 0.02% Max. resolution : $1\mu\Omega$

Max. measurable current: 300mA



■Small-signal contacts







Compact fuses, airbag inflator, compact magnetic components (EMC filters, ferrite beads)





■Multi-contact resistance measurement (motor and transformer windings)









Motors, solenoids, choke coils, transformers, wire harnesses

RM3545

RM3544

■Contacts, wire harnesses, relay contacts, switches







RM3545

RM3545

■Fuses, resistors, heaters, wires, welds







■Conductive rubber, paint





RM3544

RM3544

■ General specifications

RESISTANCE METER RM3545		RESISTANCE METER RM3544
0.00 μ Ω to 1200M Ω	Measurement types (4-terminal direct current)	0.000 m Ω to 3.5 M Ω
/	Temperature measurement, Temperature correction (TC), comparator, judgment sound setting, auto hold	✓
✓	Low power resistance measurement (LP)	N/A
✓	Temperature rise (Temperature conversion (ΔT)	N/A
✓	Offset voltage compensation (OVC)	N/A



Multi-point measurement with the Multiplexer Unit Z3003 (20 locations with 4- terminal measurement) RM3545-02

Scanning measurement using the Multiplexer Unit Z3003 is convenient in applications that require multi-contact measurement, for example when testing network resistors, steering switches, or 3-phase motor windings. Simply insert a Z3003 unit into one of the slots on the back of the RM3545-02 to enable scanning measurement of up to $20\,$ locations* with 4-terminal measurement.

(*When using two Z3003 units, up to 42 locations can be measured with 2-terminal measurement.)



Multiplexer unit Z3003 (Option)


slots on the back of the instrument.

Insert up to two Z3003 units into the

Pictured: Back of the RM3545-02 with two Z3003 units (optional feature) installed


Application 1.


Measuring a 3-phase motor winding

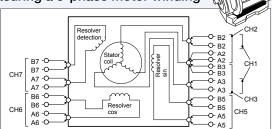

Application 3.


Testing a relay

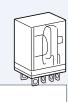

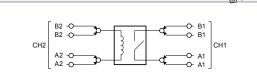


Application 2.

Testing a connector or wiring harness

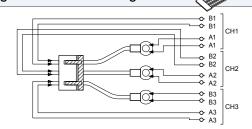

Application 4.

Testing battery terminal welds

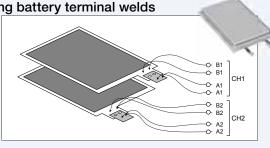

Probes suited to manual measurement on production lines RM3545



CLIP TYPE LEAD L2101 (Bundled accessory)




PIN TYPE LEAD L2102



PIN TYPE LEAD L2103



4 -TERMINAL LEAD L2104

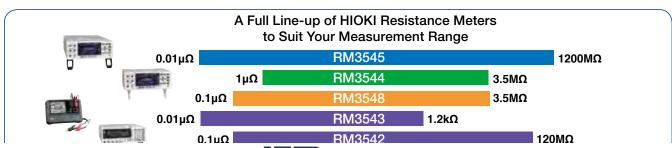

1.800.561.8187




information@itm.com

Simplifying high-accuracy resistance measurement

■ Standard features of the high-accuracy Resistance Meter RM3545 and RM3544

Convenient wide range options RM3545 RM3544

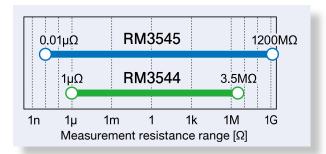





Integrate into automated inspection systems

Manual testing on production lines

Overview of the RM3545

RM3545

Measure from $0.00\mu\Omega$ to $1200.0M\Omega$ 0.01μΩ max. resolution, 0.006% basic accuracy Max.measurable current of 1A

The RM3545 can perform resistance measurement with a 6.5-digit, 1,200,000-count display at a maximum resolution of 0.01 $\mu\Omega.$ It delivers more than enough capabilities to be used in applications requiring highresolution resistance measurement, for example in testing inverter motor windings.

High-resistance materials such as conductive sheets and conductive rubber are often used in electronic components. The RM3545 can measure resistance values of up to 1,200 M Ω . It also delivers maximum accuracy of 0.006%, enabling researchers to test state-of-the-art current sensing resis-

Overview of the RM3544

RM3544

Measure from $0.000m\Omega$ to $3.5000M\Omega$ 1μΩ max. resolution, 0.02% basic accuracy Max.measurable current of 300mA

As inverter-equipped power supply equipment uses increasingly high currents and frequencies, increasingly low-resistance and low-loss inductors are being incorporated in their circuitry, prompting a need for the ability to measure lower resistance levels with a high level of stability. With a resolution of 1 $\mu\Omega$, the RM3544/RM3544-01 satisfy these needs.

Electronic components make extensive use of high-resistance substrates such as conductive sheets and rubber, and the RM3544/RM3544-01 deliver the ability to measure up to 3.5 M Ω .

Moreover, the instruments' maximum accuracy of 0.02% allows them to be used in testing current detectors with a precision of 0.1%.

• Guaranteed accuracy with no warm up or zero-adjustment RM3545 RM3544

For the RM3545/RM3544, accuracy is guaranteed* immediately after startup, without any warm up or zero-adjustment.

*When performing measurement with the RM3545 in a temperature and humidity environment that satisfies the guaranteed accuracy conditions, an even higher level of accuracy (full accuracy) is guaranteed.

High-durability probes

RM3545

HIOKI offers a line of probes designed to accommodate the full range of measurement targets. Flex resistance has been dramatically improved (based on HIOKI comparisons).



Example lead tip profiles

Offset Voltage Compensation (OVC) RM3545

Thermal EMF occurs at connections between different metals. This force can affect measurement and, if large enough, introduce a measurement error. The RM3545's offset voltage correction (OVC) function reduces the effects of thermal EMF to enable more precise measurement.


Temperature correction

RM3545 RM3544

Generally, the resistance of copper wiring changes with temperature by 0.4% per degree Celsius. The RM3544/RM3545 provide a temperature correction function to convert the observed resistance value Rt at the current temperature t to the resistance value Rt_0 at the reference temperature t_0 .

*Requires the Temperature Sensor Z2001 or a thermometer capable of generating analog voltage output (an infrared thermometer or similar instrument).

lynae at tamparatura	RM3544: Temperature Sensor (Z2001) RM3545: Temperature Sensor (Z2001), Analog voltage input (from an infrared thermometer, etc.)
Reference temperature	10.0 to 00.0 °C

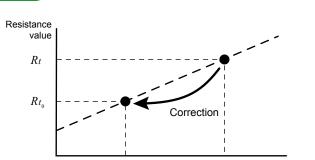

information@itm.com

1.800.561.8187

Super-high-accuracy, multi-channel resistance meter for use in advanced development and production applications

■ Key Features of the RM3545

RM3545



High/low current selection by range

Select the optimal measurement current by switching between high and low settings according to the characteristics of the sample.

Extensive contact check functionality

The RM3545 can detect erroneous measurements caused by improper contact, reducing the risk that improperly judged or unchecked parts will be shipped by mistake. Contact check functionality is also provided for 4-terminal measurement.




Low-power (LP) resistance measurement

The RM3545 can perform measurement at a resolution of 10 $\mu\Omega$ at 1 mA (using the 1,000 m Ω range). With an open-terminal voltage of 20 mV or less, the instrument is ideally suited for measuring the contact resistance of chip inductors and signal contacts.

D/A output

The RM3545 converts resistance measured values into DC voltage for output. This capability is convenient when continuously recording changes in resistance, for example as detected by a sensor, with a logger or other piece of equipment.

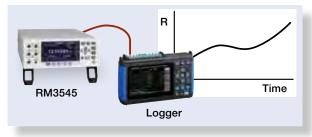

Temperature input (temperature sensor terminal)

Input temperature data for use in temperature correction using either the Temperature Sensor Z2001 or a DC voltage (0 to 2 V). Connect a thermometer that can generate DC voltage output, for example an infrared thermometer, to perform temperature correction.

Temperature conversion function: Useful in temperature-rise testing

Temperature increase (Δt) is obtained and displayed by converting resistance measurements and ambient temperature.

■ Multiplexer function (RM3545-02 only)

RM3545-02

Auto-scanning and step scanning

When using the Multiplexer Unit Z3003 to perform scanning measurement, you can select either step scanning or auto scanning depending on the test conditions.

Auto scanning is convenient when you require only an overall judgment result at the completion of scanning, while step scanning is convenient when you wish to generate judgments in real time using the instrument's EXT I/O interface..

Comparator judgments based on measurement results

Measurement targets that are susceptible to the effects of temperature, for example thermistors and temperature transducers, can be compared with a reference element to generate a judgment.

Flexible pin assignments

The ability to freely combine A terminal pin(s) with B terminal pin(s) for each channel makes it possible to perform measurement using wiring that has been optimized for a variety of measurement targets.

Acquiring Total judgment results from EXT I/O

The multiplexer's total judgment result (T_PASS, T_FAIL, T_ERR) can

Operation when auto Operation when step scanning is selected scanning is selected TRIG signal input TRIG signal input CH1 measurement CH1 judgment output CH1 measurement CHn measurement TRIG signal input CH1 measurement Overall judgment CH1 judgment output output Overall judgment

Configuration using a computer

Multiplexer settings can be configured using the keys on the instrument, communications commands, or a computer application (sample PC application). The sample application can be downloaded from Hioki's website (http://www.hioki.com).



Easy-to-use RESISTANCE METER

suits both manual operation and integration with automatic lines

High-intuitive advanced functionality

RM3545 RM3544



Guard terminals

Minimize the effects of external noise on measurements.

*GUARD terminal is the shield potential. This terminal is not for guarding network resistance measurements.

Simple control over basic settings

Range and measurement speed can be controlled directly.



LED COMPARATOR ATTACHMENT (Option)

The LED Comparator Attachment indicates judgment results with green and red LEDs, eliminating the need to look at the instrument's screen and increasing work efficiency. Since the lamps do not light up when the measurement leads are open, the attachment can also be Green light used to verify the connection status. IN state





Red light HI/LO state

High-volume, user-selectable judgment tones

The RM3544 indicates results with a high-volume judgment tone of 85 dB or greater to ensure it is audible near noisy machinery.

Both the RM3545 and RM3544 feature user-selectable judgment tones so workers don't confuse judgment results on lines where multiple resistance meters are being used.

Functionality for saving and loading panels

The RM3545 (RM3544) can save and load up to 30* (10) sets of range, comparator, and other settings. Naming each set of panel data lets you make setup changes among production lots and lines smoothly and ef-

*When using the multiplexer terminals, up to 8.


Material- and temperature-independent temperature correction function

The temperature correction function can be used to convert resistance values that vary with the ambient temperature to a reference value at a reference temperature using the Temperature Sensor Z2001 and a userspecified resistance temperature coefficient.



The scaling function can be used to convert resistance values into physical properties such as length.

> Conversion formula : $Rs = A \times R + B$ A, B: Constants, R: Measurement value Rs: Resistance value

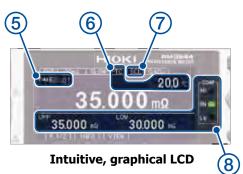

Comparator Function

The comparator function compares measured values to a previously set reference value or range and then displays and outputs the judgment result. The RM3545 and RM3544-01 can also output this information using EXT I/O.

High-precision specs in a compact package

RM3544



Footprint of just 215 × 166 mm

Compared to the previous model (HIOKI 3540), the RM3544/RM3544-01 take up approximately 25% less installation space.

This space-saving design frees up space in front of the instrument and lets you build compact production lines.





Easy integration into automatic testing equipment (RM3545/-01/-02, RM3544-01)

RM3545 RM3544

Ability to extend measurement cable length

The new instruments feature better wiring resistance tolerances than previous models (the 3541 and 3540). Wiring resistance can now be as high as 1.5 Ω for the RM3545 and 2 Ω for the RM3544.

High-speed, comprehensive productivity support

- The RM3545 and RM3544-01 deliver the speed demanded by automatic testing equipment at a sophisticated level. The entire process from the start of measurement to outputting of the judgment result takes as little as 2.2 ms*1 (RM3545) and 18 ms (RM3544-01). One cycle of operation, lasting from measurement to judgment output, completes within this *1 When the measurement current is set to "High".
- The instrument's USB interface can also be used.

- The RM3545 and RM3544-01 support RS-232C data communications at up to 115.2 kbps*2.
- The EXT I/O output mode can be switched between judgment mode and BCD mode.
- *2 With some computers, large error components may prevent fast transfer speeds (baud rates) from being used. In this case, change the speed to a lower setting

Handler (EXT I/O) interface


The handler interface (EXT I/O) is isolated from measurement circuitry, control circuitry, and the protective ground (chassis ground), providing a high level of noise resistance.


■ EXT I/O Input and Output Circuits

A switch on the rear panel is used to toggle the input signal polarity between NPN (sink output support) and PNP (source output support) settings depending on the PLC common polarity.



EXT I/O polarity (Select NPN/PNP)

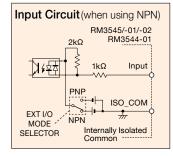

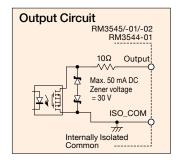

EXT I/O interface, be sure to read the instruction manual and check the necessary technical information.

When designing a control system using the

EXT I/O Electrical Specifications

Inputs:

Photocoupler isolation: Non-voltage contact inputs (support for current sink output) Input ON: Residual voltage: Max. 1 V @4 mA Input OFF: Open Max. 100 µA

Outputs:

Photocoupler-isolated open drain output (no-polarity) DC30Vmax, DC50mAmax/ch Residual voltage: Max. 1 V @50 mA, or 0.5 V @10 mA

External power output:

Output voltage: Sink output support: 5.0V±10%, Source output support: -5.0V±10% Max. output current: 100mA

■ EXT I/O Signal List

RM3545

RM3545

www itn com

Input Signals:

TRIG(IN0), CAL, KEY_LOCK, 0ADJ, PRINT(IN1), MUX, SCN_STEP, LOAD0 to LOAD5, BCD_LOW

[Judgment mode] EOM, ERR, INDEX, HI, IN, LO, T_ERR, T_PASS, T_FAIL, BIN0 to BIN9, OB, OUT0 to OUT2

[BCD mode] EOM, ERR, IN, HILO, BCDm_n*, RNG_OUT0 to Indicates the nth bit of the mth digit. RNG OUT3

RM3544-01

RM3544

Input Signals:

TRIG(IN0), KEY_LOCK, 0ADJ, PRINT(IN1), LOAD0 to LOAD3, BCD_LOW

Output Signals:

[Judgment mode] EOM, ERR, INDEX, HI, IN, LO, OUT0 to OUT2 [BCD mode] EOM, ERR, IN, HILO, BCDm_n*, RNG_OUT0 to

RNG_OUT3 * Indicates the nth bit of the mth digit.

Communications Monitor Function for smooth systems development

The Communications Monitor Function displays communications data (received commands and sent data) on the screen, providing valuable support for programming of programmable logic controllers (PLCs).

Functionality for verifying the EXT I/O connection status and testing EXT I/O

In addition to allowing you to check EXT I/O signal input on the instrument's

INT | 30mΩ | FAST | O ADJ | RMT 30.000 mΩ 20.0 ℃ COMMAND MONITOR MUNITOR RM3544-01,0000000000,V1.00 ↓ RANG 10E-3↓ RATE FAST↓ LOCAL

Communications Monitor screen





Connecting the instrument to a computer via RS-232C or USB


- Use a PC to control RM3545 and RM3544-01 functions as well as acquire measurement results.
 - (This capability does not include turning the instrument on and off or configuring certain interface settings.)
- Connect the instrument to a commercially available RS-232C printer to print measured values, including judgment results.
- Measured values can be automatically output. By using the instrument's USB keyboard mode, measured values can be entered into applications such as spreadsheets and text editors without the need to install a special USB driver in the computer.
- The sample PC application provides functionality for capturing data based on trigger signals, performing interval measurement, conducting communication tests, and loading captured data into Microsoft® Excel or outputting it as a CSV file. The application can be downloaded from Hioki's website (http://www.hioki.com).



Applications screen

■ RM3545-02 rear panel


RM3545

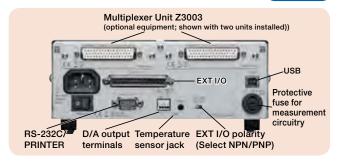

*Multiplexer Units cannot be installed in the RM3545 or RM3545-01. The RM3545-01 has a GP-IB connector.

● RM3544-01 rear panel

RM3544

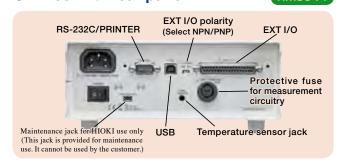

*The RM3544 does not include EXT I/O or communication interfaces (RS-232C or USB). Select the RM3544-01 for these functions.

RM3545

RM3544

RM3545-02

Interface and EXT I/O selection

Select the interfaces and EXT I/O capability needed for your application.

RM3545 serie	es comparison chart	(Base model)	-01	-02
External I/O (comparator, B	CD, BIN function)	1	1	/
Communication	RS-232C/Printer/USB	✓	1	/
interfaces	GP-IB	N/A	1	N/A
Multiplexer* (sc	anner function)	N/A	N/A	✓ (Max. 20 channels)

 $[*]When using 4-terminal \ measurement \ with \ two \ MULTIPLEXER \ UNIT \ Z3003 \ (option) \ cards.$

RM3544 series comparison chart	(Base model)	-01
External I/O (comparator, BCD)	N/A	1
Communication interfaces RS-232C/Printer/USB	N/A	✓

■ MULTIPLEXER UNIT Z3003 Specifications

Measurement targets	4-wire: 10 locations (when using 2 units, 20 locations) 2-wire: 21 locations (when using 2 units, 42 locations)
Measurable range	[Measurement current] Internal instrument: 1A DC or less External instrument: 1A DC or less, 100 mA AC or less [Measurement frequency] External instrument DC, 10 Hz to 1 kHz
Contact specifications	Contact type: Mechanical relay Maximum allowable voltage: 33 V RMS and 46.7 V peak or 70 V DC *1 Maximum allowable power: 30 W (DC), (Resistance load) Contact service life: 4-wire: 50 million cycles*2 (reference value)
B	Approx. 92W × 24.5H × 182D mm (3.62"W × 0.96"H ×

Product warranty: 1 year

*Example scanning times The Z3003 switching time is

he Z3003 :	e Z3003 switching time is 30 ms/ch.							
Range	Number of channels	Measurement speed	Delay	Time to output judgment results after TRIG input (When the measurement current is set to "High".)				
$1000 \mathrm{m}\Omega$	10	FAST	0 ms	Approx. 300ms				
10000	10	EACT	Danast	A				

^{*1} Cannot be used in combination with a withstand voltage tester. When used with a withstand voltage tester, the Z3003's internal relay will cause an insulation breakdown, resulting in electric shock or equipment damage.

^{*2} Assuming 24-hour operation, the guideline of 50 million cycles corresponds to approximately 1.5 years on a line operating at 1 sec. per workpiece or approximately 15 years on a line operating at 10 sec. per workpiece.



■ RM3545/RM3544 Specifications

Product warranty: 1 year

Measurement types Measurement method Range switching Temperature correction	Resistance measurement: $0.000~00m\Omega~(10m\Omega~range)$ to $1200.0M\Omega~(1000M\Omega~range)$, 12 ranges Low power resistance measurement: $0.00m\Omega~(1000m\Omega~range)$ to $1200.00\Omega~(1000\Omega~range)$, 4 ranges Temperature measurement (thermistor): -10.0 to 99.9°C	Resistance measurement: $0.000 \text{m}\Omega$ ($30 \text{m}\Omega$ range) to 3.500 0M Ω ($3M\Omega$ range), 9 ranges					
Measurement method Range switching Temperature correction	Low power resistance measurement: $0.00 m\Omega$ ($1000 m\Omega$ range) to 1200.00Ω (1000Ω range), 4 ranges Temperature measurement (thermistor): -10.0 to 99.9°C	$3.500 0 \text{M}\Omega (3 \text{M}\Omega \text{range}), 9 \text{ranges}$					
Range switching Temperature correction	1 1	Resistance measurement: 0.000ms2 (30ms2 range) to					
Range switching Temperature correction	Temperature measurement (analog input): -99.9 to 999.9°C						
Temperature correction	4-terminal direct current (constant curren	t), banana plug, with guard terminal					
·	Auto or Manual						
	Reference temperature setting range: -10°C to 99.9°C, Temperature coefficient setting range: -99,999 ppm/°C to 99,999 ppm/°C	Reference temperature setting range: -10°C to 99.9°C, Temperature coefficient setting range: -9,999 ppm/°C to 9,999 ppm/°C					
Zero-adjustment	By range, by step (RM3545-02 only) Within $\pm 50\%$ f.s. of each range. (Zero-adjustment is not required for $100 \text{ M}\Omega$ or greater ranges.)	Within -3% to 50% f.s. of each range. (f.s.= 30,000 dgt.)					
Trigger	Internal or external	RM3544: Internal trigger, RM3544-01: Internal or externa					
Measurement speed	FAST / MED / SLOW1 / SLOW2	FAST / MED / SLOW					
Delay	Internal fixed value: / 0 to 9999 ms (1ms step)	N/A					
Functions	Temperature correction, Temperature conversion, Self-calibration, offset voltage compensation (OVC), comparator (ABS/REF%), BIN, key-lock (OFF, menu lock, all lock), display digit count selection function (7 digits/6 digits/5 digits), automatic power supply frequency settings (AUTO/50Hz/60Hz), scaling, judgment sound setting, auto hold, statistical calculations, clock, self-test, L2105 LED Comparater Attachment output						
Measurement fault detection functions	Contact check, over detection, current fault detection	Over detection, current fault detection					
Averaging	OFF, 2 to 100 averaging iterations	(variable in 1-iteration steps)					
rttoraging	30 (Front terminals), 8 (MUX (multiplexer))	10					
Panel store, panel load	Panel save parameters: save time and date, resistance measurement ranges, measurement speed, comparator, BIN setting, multiplexer setting, etc.	Panel save parameters: resistance measurement ranges measurement speed, comparator, etc.					
Multiplexer	Measurement terminal settings: Front terminals / MUX (multiplexer) When using the MUX setting, the measurement leads cannot be connected to the front measurement terminals Support unit: Z3003 Number of channels that can be set: 42, switching time 30 ms (reference value)	N/A					
D/A output	Output: resistance measured value Output voltage: 0V DC to 1.5V DC Output impedance: 1k\Omega Number of bits: 12bit	N/A					
EXT I/O	TRIG and other, BIN, BCD	RM3544-01: TRIG and other, BCD					
Communication	Select from GP-IB*, RS-232C, PRINTER(RS-232C), or USB	RM3544-01:					
inter <u>faces</u>	*RM3545-01 only	Select from RS-232C, PRINTER(RS-232C), or USB					
Communication interfaces	Remote function, communications monitor function, data output function, memory (50 data)	Remote function, communications monitor function, data output function					
RS-232C	Bit rates: 115,200 / 38,400 / 19,200 / 9,600 bps						
USB	Class: CDC (COM mode), HID (USB keyboar Printed data: Resistance measurement values, temperature mea-	d mode) Printed data: Resistance measurement values, temperature					
Printer (RS-232 port)	surement values, judgment results, measurement conditions, statistical results	measurement values, judgment results, measurement con					
	Operation: Prints at PRINT signal or PRINT key inpu Interval: ON/OFF, Interval times: 1 to 3,600 s (variable	e in 1 s steps), Number of print columns per row: 1 or 3					
Operating temperature and humidity	0 to 40°C, 80% rh or less	(non-condensating)					
Storage temperature and humidity	–10 to 50°C, 80% rh or les	s (non-condensating)					
Operating environment	Indoors, Pollution Degree 2	*					
Power supply	Rated supply voltage: 100 to 240 VAC ±10						
Rated power consumption	40 VA	15 VA					
Insulation withstand	1.62 kV AC for 1 min. (with 10 mA cutoff currer	**					
potential Dimensions	between all mains supply terminals and protecti Approx. 215W × 80H × 306.5D mm (8.46"W × 3.15"H × 12.07"D) (without projections)	ve ground, interfaces, and measurement terminals Approx. 215W × 80H × 166D mm (8.46"W × 3.15"H : 6.54"D) (without projections)					
Mass	RM3545, RM3545-01: Approx. 2.5 kg (88.2 oz) RM3545-02:Approx. 3.2 kg (112.9 oz) (not including Z3003)	RM3544: Approx. 0.9 kg (31.7 oz) RM3544-01:Approx. 1.0 kg (35.3 oz)					
Accessories	Power cord ×1, CLIP TYPE LEAD L2101 ×1, temperature sensor Z2001 ×1, male EXT I/O connector ×1, instruction manu-	Power cord ×1, CLIP TYPE LEAD L2101 ×1, male EX I/O connector* ×1, instruction manual ×1, application disc					



■ Measurement accuracy

RM3544

Conditions of guaranteed accuracy

- Temperature & humidity: 23 °C ±5 °C, 80% rh or less (non-condensating)
- From 0°C to 18°C and from 28°C to 40°C, add (temperature coefficient ±[1/10 measurement accuracy] / °C).
- Guaranteed Accuracy Period: 1 year
- RM3545 only: Warmup time of 60 min. or greater (If less than 60 min., double figures in the accuracy table to obtain the measurement accuracy.
- RM3545 only: self-calibration AUTO

* During temperature correction, the value calculated below is added to the rdg. error for resistance measurement accuracy:

to: Reference temperature. [°C]

Ambient temperature. [°C]

 Δt : Temperature. measurement accuracy

RM3545

■ Resistance measurement accuracy

RM3545

Accuracy = \pm (% rdg. + % f.s.)

LP OFF

- f.s. = calculated 1,000,000 dgt., where 0.001% f.s. = 10 dgt.
- For 100 M Ω and greater ranges with 100 M Ω range high-precision mode off, calculate as f.s. = 10,000 dgt. and 0.01% f.s. = 1 dgt.

 RM3545 only: Warmup time of 60 min. or greater (If less than 60 min., double figures in the accuracy table to obtain the measurement accuracy.) RM3545 only: self-calibration AUTO 	$1 + \alpha_{t0} \times (t + \Delta t - t_0)$	accuracy α_{t0} :Temperature. coefficient at $t0$ i [1/°C]
*When using manual self-calibration, temperature fluctuations after performing calibration	on must be within ±2°C, and the	e calibration interval must be within 30 min.
■ Resistance measurement accuracy		

(Example) 0.006 + 0.001 0.006% rdg. + 0.001% f.s.

×100 [%]

 $-\alpha_{t0}\Delta t$

Range	100MΩ range high-	Max. measurement	Reso-		Accuracy %rdg. + %f.s. *2			Measur curre		Additional accuracy without	Max open- terminal
nalige	precision mode	display *1	lution	FAST	MED	SLOW1	SLOW2	Switching		0ADJ %f.s. ^{*2}	voltage
10mΩ		12.000 00 mΩ	10 nΩ	0.060+0.050	0.060-	+0.020	0.060+0.020		1A	0.020	
1011122		12.000 00 11152	10 1152	(0.060+0.015)	(0.060-	+0.002)	(0.060+0.001)		1A	(-)	
				0.060+0.010	0.060-	+0.010	0.060+0.010	High	1A	0.002	
100mΩ		120.000 0 mΩ	100 nΩ	(0.060+0.003)	· · · · · · · · · · · · · · · · · · ·	(0.060+0.001) (0.060+0.001)		111.511		(-)	
10011122		120.000 0 1112	0.014+0.050 0.014+0.020 0.014+0.020		Low	100mA	0.020				
				(0.014+0.015)	(0.014-	-0.002)	(0.014+0.001)	2011	10011111	(-)	
				0.012+0.010		0.012+0.008		High	100mA	0.002	
1000mΩ		1200.000 mΩ	1 μΩ	(0.012+0.003)		(0.012+0.001)				(-)	
			•	0.008+0.050		0.008+0.020		Low	10mA	0.020	
	-			(0.008+0.015) 0.008+0.010		(0.008+0.002)				0.002	5.5V *4
				(0.008+0.010			High	10mA	(-)		
10Ω	_	12.000 00 Ω 10 μΩ		0.008+0.003)		0.008+0.001)				0.020	
				(0.008+0.030		(0.008+0.002)		Low	Low 1mA	(-)	
	-			0.007+0.005	0.007+0.002	, ,				_	
				(0.007+0.005)	(0.007+0.001)		+0.001)	High	10mA	(-)	
100Ω		120.000 0 Ω	100 μΩ	0.008+0.010	0.008+0.010		_		0.002		
				(0.008+0.003)		(0.008+0.001)		Low	1mA	(-)	
10000		1200.000 Ω	1 mΩ	0.007+0.005	0.006+0.002	0.006	+0.001		1mA	-	
1000Ω		1200.000 Ω	1 11152	(0.007+0.005)	(0.006+0.001)	(0.006	+0.001)		IIIIA	(-)	
10kΩ		12.000 00 kΩ	10 mΩ	0.008+0.005	0.007+0.002	0.007	+0.001		1mA		
100kΩ		120.000 0 kΩ	100 mΩ	0.008+0.005	0.007+0.002	0.007-	+0.001		100μΑ		
1000kΩ		1200.000 kΩ	1 Ω	0.015+0.005	0.008+0.002	0.008+0.002]	10μΑ		
10ΜΩ	-	12.000 00 MΩ	10 Ω	0.030+0.005	0.030+0.002		-	1μΑ			
	ON	120.000 0 MΩ	100 Ω	0.200+0.005	0.200+0.002			100nA	_	20V	
100ΜΩ	OFF	120.00 ΜΩ	10 kΩ	10.00MΩ or less : 0.50+0.02							
	OFF	120.00 M122	10 K12	$10.01M\Omega$ or more : $1.00+0.02$				Max.			
1000ΜΩ	OFF	1200.0 MΩ	100 kΩ		100.0MΩ or less: $1.00+0.02$				1μA		
100010122	OFF	1200.0 1/122	100 K22		100.1MΩ or more : $10.00+0.02$						

^{*1} For negative values, to -10% f.s. The maximum display range is 9,999,999 dgt. or 9 GQ. (An over-range error will be indicated when the maximum measurement range is exceeded, even if the maximum display range is not exceeded.)

LP ON • f.s. = calculated 100,000 dgt., where 0.001% f.s. = 1 dgt.

Panga	100MΩ range high-	Max. Reso-		Measurement current *3		Additional accuracy without	Max open- terminal				
Range	precision mode	measurement display *1	lution	FAST	MED	SLOW1	SLOW2	Switching		0ADJ %f.s. *2	voltage
1000mΩ		1200.00 mΩ	10 μΩ	0.200+0.010	0.200+0.010	0.200+0.005	0.200+0.003		1mA		
10Ω		12.000 0 Ω	$100~\mu\Omega$	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002		500μΑ		20mV *5
100Ω	_	120.000 Ω	$1~\text{m}\Omega$	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002	_	50μΑ	_	20111
1000Ω		1200.00 Ω	$10~\mathrm{m}\Omega$	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002		5μΑ		

^{*1} For negative values, to -10% f.s. The maximum display range is 9,999,999 dgt. or 9 GQ. (An over-range error will be indicated when the maximum measurement range is exceeded, even



^{*2} Measurement accuracy figures reflect accuracy after zero-adjustment. If not performing zero-adjustment, add the figures shown in the "Additional accuracy without 0ADJ" column. Figures shown in parentheses on the second line indicate the additional accuracy with OVC on.

^{*3} Measurement current accuracy is ±5%.

^{*4} When using an external trigger source or performing measurement with continuous measurement set to off (other than free-run), the open-circuit voltage from 1 ms after the completion of measurement (INDEX = ON) to the start of the next measurement (TRIG = ON) is limited to 20 mV or less.

Additional accuracy when using the Z3003

When performing measurements using the Z3003, the following uncertainties are added to the RM3545 specifications (accuracy):

Effects of leak current	Add a reading error shown on right depending on the measurement current (when using guarding) (With humidity of less than 70% RH. If the humidity is greater than or equal to 70% RH, add the following rdg. error \times 5.):		I _{MEAS} : Measurement current
Effect of measurement speed	Add the f.s. error component shown on right when the integration time is not a whole-number multiple of the power supply cycle:	$A_{\rm fs} \times 0.5$ [%rdg.]	A _{fs} : f.s. error component for RM3545-02 with
Effect of offset voltage	Add the resistance shown on right to the error when OVC is OFF:	$\frac{10\times10^{-6}\mathrm{[V]}}{I_{\mathrm{MEAS}}[\mathrm{A}]}\mathrm{[\Omega]}$	Z3003
Effect of offset resistance fluctuations	When using a 2-wire setup, add the wiring resistance shown on right to the error component.	0.1 Ω	
Temperature coefficient	From 0°C to 18°C and 28°C to 40°C, add a temperature coefficient of ±(1/	/10 of additional accuracy) / °C.	

PRM3544

RM3544

Accuracy = \pm (% rdg. + % f.s.)

• f.s. = calculated 30,000 dgt., where 0.010% f.s. = 3 dgt.

(Example) 0.020 + 0.007 0.020% rdg. + 0.007% f.s.

Range	Max. measurement display*6,*7	FAST	MED/SLOW	Measurement Current*8	Open-Circuit Voltage
$30 \mathrm{m}\Omega$	35.000 mΩ	0.030+0.080	0.030+0.070	300mA	
$300 \mathrm{m}\Omega$	350.00 mΩ	0.025+0.017	0.025+0.014	300mA	
3Ω	3.500 0 Ω	0.025+0.017	0.025+0.014	30mA	
30Ω	35.000 Ω	0.020+0.010	0.020+0.007	10mA	
300Ω	350.00 Ω	0.020+0.010	0.020+0.007	1mA	5.5Vmax.
3kΩ	3.500 0 kΩ	0.020+0.010	0.020+0.007	1mA	
30kΩ	35.000 kΩ	0.020+0.010	0.020+0.007	100μΑ	
300kΩ	350.00 kΩ	0.040+0.010	0.040+0.007	5μΑ	
3ΜΩ	3.500 0 MΩ	0.200+0.010	0.200+0.007	500nA	

^{*6} For negative values, to -10% f.s.

■ Temperature measurement accuracy (RM3544/RM3545)

• Temperature Sensor Z2001 (for RM3544/RM3544-01)

RM3545 | RM3544

RM3545

Range of guaranteed accuracy	-10.0 to 99.9 °C
Display refresh rate	Approx. 2 s
Guaranteed accuracy period	1 year

• Temperature Sensor Z2001 and RM3545/RM3544/RM3544-01 combined accuracy

t: Temperature measurement values [°C]

Temperature	Accuracy
-10.0 °C to 9.9 °C	$\pm (0.55 + 0.009 \times \text{t-}10) ^{\circ}\text{C}$
10.0 °C to 30.0 °C	± 0.50 °C
30.1 °C to 59.9 °C	$\pm (0.55 + 0.012 \times \text{t-30}) ^{\circ}\text{C}$
60.0 °C to 99.9 °C	$\pm (0.92 + 0.021 \times t-60)$ °C

Standalone instrument accuracy: ± 0.2 °C

 Analog Input (for RM3545)

Guaranteed accuracy range 0 to 2 V 2.5V Maximum allowable voltage Resolution 1mV Display range -99.9 to 999.9 °C Approx. 50 ms, Measurement period (speed) no moving average Period of quaranteed accuracy 1 year Accuracy ±1%rdg. ±3 mV

Resistance D/A output accuracy (RM3545)

RM3545

Output accuracy	Resistance measurement accuracy ±0.2%f.s., (temperature coefficient ±0.02%f.s./°C)
Response time	Measurement time + Max. 1 ms

Measurement speed typical values (RM3545) RM3545

■ Measurement time (RM3544)

RM3544

	Measurement current	Measurement speed (ms)					
Range		FAST	MED		CI OWA	SLOW2	
			50Hz	60Hz	SLOW1	SLOWZ	
10 mΩ	N/A	41	61	58	141	241	
$100~\mathrm{m}\Omega$	High	41	61	58	141	241	
$1000~\mathrm{m}\Omega$	High	2.2	22	19	102	202	
10 Ω	High	2.2	22	19	102	202	
100 Ω	High	2.8	23	20	103	203	

Tolerance: ±10% ±0.2 ms

Measurement speed (ms)				
FA	ST	MED	SLOW	
50Hz	60Hz	MED		
21	18	101	401	

Tolerance: ±10% ±2 ms

^{*} Shortest time when using an external trigger source or with continuous mea-



^{*7} The maximum display range is 99,999dgt.

^{*8} Measurement current accuracy is ±5%.

^{*} With TC set to ON and the comparator set to ON

■ Model Configurations and Options



RESISTANCE METER RM3545 RESISTANCE METER RM3545-01 (with GP-IB)

RESISTANCE METER RM3545-02

(supports use of the MULTIPLEXER UNIT Z3003)

(Accessories: Power Cord ×1, CLIP TYPE LEAD L2101 ×1, TEMPERATURE SENSOR Z2001 ×1, male EXT I/O connector ×1, instruction manual ×1, applications disc ×1, USB cable (A-to-B type) ×1, extra fuse ×1)

Caution when considering the use of probes without guard terminals

Proper operation of the RM3545 and RM3544 is not guaranteed when using test leads (test probes) that lack guard terminals, for example test leads used with models such as the Resistance HiTester 3541 or $m\Omega$ HiTester 3540. Please use the test leads indicated in the RM3545 and RM3544 accessory and option documentation.



RESISTANCE METER RM3544

(Accessories: Power cord ×1, CLIP TYPE LEAD L2101 ×1, instruction manual ×1, extra fuse ×1)

RESISTANCE METER RM3544-01

(EXT I/O, with communication interface)

(Accessories: Power Cord ×1, CLIP TYPE LEAD L2101 ×1, male EXT I/O connector ×1, instruction manual ×1, applications disc ×1, USB cable (A-to-B type) ×1, extra fuse ×1)

Options





MULTIPLEXER UNIT Z3003

Test Leads

Note on probe length

B: Probe length
L: Overall length



Q

CLIP TYPE LEAD L2101
(Bundled accessory)
B: 83 mm (3.27 in), L: 1.5 m (4.92 ft)

4 -TERMINAL LEAD L2104 B: 118 mm (4.65 in), L: 1.5 m (4.92 ft)





TEMPERATURE SENSOR Z2001

(RM3545/RM3545-01/ RM3545-02 Bundled accessory, RM3544/RM3544-01 Option)





LED COMPARATOR ATTACHMENT L2105 2 m (6.56 ft) PC Communication

RS-232C CABLE 9637

for PC connection, 9pin - 9pin, cross, 1.8 m (5.91 ft)

RS-232C CABLE 9638

for PC connection, 9pin - $25pin,\,cross,\,1.8$ m (5.91 ft)

GP-IB CONNECTOR CABLE 9151-02 2 m (6.56 ft)

2 | PIN



PIN TYPE LEAD L2102
B: 140 mm (5.51 in), L: 1.5 m (4.92 ft)



PIN TYPE LEAD L2103 *B*: 138 mm (5.43 in), *L*: 1.5 m (4.92 ft)

Related products

■ Large motors, large transformers





Vehicle grounding lines, conductivity of aircraft fuselages





■ Temperature rise tests (Motors, choke coils, transformers)





High-precision portable resistance meter

measures from $\mu\Omega$ to $M\Omega$



RESISTANCE METER RM3548

Basic accuracy : 0.02%

Max. resolution : $0.1 \mu\Omega$

Max. measurable current : 1A

- Measure from 0.0 μΩ (@ 1 A) to 3.5 MΩ
- Easily record up to 1,000 data points in memory simply by applying the instrument's probes.
- Smoothly capture temperature-rise test data using interval measurement.
- Portable design is ideal for maintenance and testing of large equipment.

For more information, please visit http://www.hioki.com.